

OPTIMA USER MANUAL



Producer:



MRU · Messgeräte für Rauchgase und Umweltschutz GmbH

Fuchshalde 8 + 12 74172 Neckarsulm-Obereisesheim Fon 07132 99620 · Fax 07132 996220 info@mru.de · www.mru.eu

Legal notices / Intellectual property rights comments Original user manual © 2022 by MRU No part of this manual my be published in any form (print, fotocopy, electronic media or any other publication form) without a written approval by the publisher. All user trade marks and name mark descriptions, even those which are not marked as such, are properties of the respective owners.

Edition: 2023-01-23,V.1.12.EN

| Table | of contents | |
|-------|---|----------------------|
| 1 Inf | ormation for product and safety | 7 |
| 1.1. | Safety manual | 7 |
| 1.2. | Safety precautions | 7 |
| 1.3. | Ensure safety | 8 |
| 1.4. | Important general information (EN 50379 and VDI 4206) | 8 |
| 1.5. | User guideline for rechargeable batteries | 9 |
| 2 Int | roduction | 10 |
| 2.1. | Intended use | 10 |
| 2.2. | About us | 11 |
| 2.3. | Packaging | 12 |
| 2.4. | Return of hazardous materials | 12 |
| 2.5. | Return of electronic equipment | 12 |
| 3 De | scription | 13 |
| 31 | Gas flow diagram | 13 |
| 3.2. | Analyser | 14 |
| 3.3. | Condensate seperator (water trap) | 15 |
| 3.4. | Extraction probes | 19 |
| | | |
| 4 Op | perating | 20 |
| 4.1. | Display | 20 |
| 4.2. | Keypad | |
| 4.3. | Menu structure | 22 |
| 5 Fir | st usage | . 23 |
| 5.1. | Preparatory steps | 23 |
| 5.2. | Customize settings | 23 |
| 5.3. | Export and import settings | 25 |
| Exi | port user settings | 25 |
| Im | port user settings | 26 |
| | | |
| 5.4. | Set measurement | 26 |
| 5.5. | Set Bluetooth parameters | 28 |
| 5.6. | Setting date and time | 29 |
| 5.7. | Configure measurement program | 29 |
| 5.8. | Set CO-Limit | 30 |
| 5.9. | Change measurement program name | 30 |
| 5.10. | Select fuel types and O ₂ reference | 31 |
| Ad | d fuels to fuel type selection | 31 |
| Se | t O2-reference | 32 |
| 5 11 | Define user fuel type | 22 |
| 5.17 | Define measurement window | ے د. 24 |
| 5 13 | Configure zoom window | ب و ۲۶ |
| 5.15. | | |

| 6 | Pre | pare measurement | 36 |
|---|------|---|------------------|
| | 6.1. | Perform overall visual inspection | |
| | 6.2. | Ensure power supply | |
| | 6.3. | Automatic Auto-off function | |
| | 6.4. | Measuring with grid power supply / Battery charging | |
| | 6.5. | Measurements in battery mode (battery monitoring) | |
| | 6.6. | Operating temperature | |
| | 6.7. | Control Condensate separator | |
| | 6.8. | Connections and tightness | |
| | 6.9. | Automatic zero point | |
| | _ | | |
| | Rep | beat zeroing | |
| 7 | Per | forming measurement | |
| | 7.1. | Perform Gas measurement | 39 |
| | Cor | e flow search | 29 |
| | Sel. | et Measurement program | |
| | Mo | asurement window | |
| | | nurging | |
| | 0 | purging | ······ <i>¬∠</i> |
| | 7.2. | Performing measurements with measurement assistant | 43 |
| | Swi | tch on the measurement assistant | 43 |
| | Use | e templates | 43 |
| | Col | lect measurement | 44 |
| | Res | et collected measurements | 46 |
| | Prir | nt collected measurements | 47 |
| | Ind | ividualise function key F2 | 48 |
| | Tra | nsmitting measurements to MRU4u | 49 |
| | Tra | nsmitting measurements to MRU4u via QR code | 50 |
| | Tra | nsmitting measurements via QR code ZIV | 50 |
| | Sto | re measurements | 51 |
| | Ser | id messages as E-Mail | |
| | 7 2 | Tomporary buffer | БЭ |
| | 1.5. | Temporary burier | |
| | Sto | re values into temporary buffer | 53 |
| | Ove | erwrite measured values in temporary buffer | 55 |
| | 7.4. | Perform Annular-gap test | |
| | 7.5. | Perform Test program | |
| | 7.6 | CO/H2 and CO high (optional) | |
| | 7.7 | Non-continuous draft measurement | |
| | 7.8 | Perform pressure measurement | |
| | 7.9 | Perform Differential temperature measurement | |
| | 7.10 | Store measurement values | |
| | | | |
| | Ent | er T-boiler, Soot and Derivative | 61 |

| 7.11 | . Print measurement values | 62 |
|-------------|---|----------|
| Or | pen menu print-out | 62 |
| Pri | int measurement results with Speedprinter | 63 |
| Pri | int measurement results with Highspeed-Bluetooth- | |
| Th | ermoprinter | 65 |
| | • | |
| 7.12 | Stop measurement | 66 |
| 7.13 | Last measured values | 66 |
| 8 Da | ata storage | 67 |
| 8.1. | Organize data storage | 67 |
| 8.2. | Call up information about Memory info | 67 |
| 8.3. | Sites administration | 68 |
| C | | 60 |
| Cr | eate new site | 68 |
| | ew sites | 69 60 |
| | lange sites | 09 70 |
| | | 70 |
| 8.4. | Transfer data via using SD card | 71 |
| lina | nort sites | 70 |
| III Ev | port sites | 12 |
| LX Ev | port measurements | 75 7/ |
| LA | port measurements | / 4 |
| 8.5. | Measurements in Data storage | 75 |
| Vi | ew measurements | 75 |
| De | elete measurements | 75 |
| | | |
| 9 Ex | tras / Adjustment | 78 |
| 9.1. | Service menu | 78 |
| 9.2. | Default settings | 79 |
| 9.3. | Service values | 80 |
| 9.4. 0.5 | Performing leak test | ا 8 |
| 9.5. | Contents SD card | _28 |
| 9.0. | Device III0 | 05 |
| Op | otions list | 83 |
| Se | rvice history | 84 |
| 10 | Maintonanco and caro | 95 |
| 10 1 | Cleaning and care | 05 |
| 10.1 | Maintenance | נט אכ |
| 10.2 | Service messages | 85 |
| 10.0 | | |
| 11 | Option Gas flow measurement | 86 |
| 11.1 | . Connect Prandtl (Pitot) tube | 86 |
| 11.2 | . Open menu Gas flow measurement | 87 |
| 11.3 | . Define settings and parameters | 88 |

| 11.4. Enter Cross section area89 11.5. Perform measurement |
|---|
| 12 Option: Monitoring flow rate |
| 14 Option: Perform measurements with Extraction box94 |
| 14.1. Attach Extraction box to analyser94 |
| 14.2. Connect Extraction box to analyser95 |
| 14.3. Activate Extraction box96 |
| 14.4. Perform measurement97 |
| 15 Prefilter for high dust concentrations |
| 16 Appendix |
| 16.1. Technical data99 |
| 16.2. Analysis and calculation104 |
| 16.3. Reset analyser106 |
| 16.4. Troubleshooting107 |
| Troubleshooting on the analyser107 |
| Troubleshooting condensate separator108 |
| 16.5. Update firmware109 |
| Check current firmware version109 |
| Prepare SD card109 |
| Perform firmware update109 |
| Check new firmware version110 |
| 16.6. Display your own logo112 |
| Create your own logo112 |
| Import logo into analyser114 |
| 17 Declaration of conformity115 |

1 Information for product and safety

1.1. Safety manual

All general information and safety precautions of MRU products are listed in the supplied separate safety manual.

Therefore, this manual must be read and observed before the first use of the instrument.

Instrument-specific safety and warning requirements in this manual are prefixed before dangerous actions.

1.2. Safety precautions

The used categories of safety precautions are here explained once more.



surroundings.

NOTE

Identifies user tips and other especially important information.

The explanation of safety notices:



▲ CAUTION

HOT – danger of burns and fire hazards from gas extraction probe.

Physical harm and property damage can be caused.

► Cool down the probe tube.

1.3. Ensure safety

- ▶ Please read the user manual completely before the first use.
- Only use the analyser for the intended use and within the parameters specified in the technical data.
- ► Do not use any violence.
- ► Avoid falls
- Do not put the analyser into use, if the housing, power supply unit or supply leads are damaged.
- ► Do not store the analyser together with solvents. Do not use desiccants.
- Only carry out maintenance and service work on this analyser as described in the User Manual. Observe the prescribed action steps.
- Operate the analyser only in closed, dry rooms and protect it from rain and moisture.
- ► When operating the analyser on mains power, operate it only with the mains adapter supplied.
- ► Do not use the metal tube of the gas sampling probe or other metallic parts / accessories as electrical conductors.
- The analyser must not be located in the immediate vicinity of open fire or great heat.
- The specified temperature range of the gas sampling probe must not be exceeded, otherwise the probe tube and temperature sensor will be destroyed.

1.4. Important general information (EN 50379 and VDI 4206)

- The analyser is not designed to be used for continuous measurements
- Before using the analyser verify the condition of the various parts of the analyser, such as the probe, the ambient air conditions, the condensate separator, star filter and the connectors for damage and/or blockages.
- When starting the analyser up it will take between 1 3 minutes to set to zero depending on the condition of the sensors and ambient conditions. (Zeroing).
- The minimum zeroing time of the analyser to achieve correct measurement values can be expected by 1.5 minutes!
- Exposure to acids; aggressive gases such as Sulphur; vapours such as thinners, gasoline, alcohol and paint, etc. can damage, reduce the life of, or destroy the sensors
- Die Lebenserwartung der Sensoren beträgt, abhängig von Nutzung, Wartung und Pflege des Messgerätes bei dem O₂ Sensor ca. 2 Jahre und bei dem CO Sensor ca. 2-3 Jahre.
- The life of the sensors depends on how they are used, maintained and treated. Typical average life expectations are: O2 - 2 years; CO -2 - 3 years and NO - 3 years.

 The use of the analyser for regulatory purposes is subject to special regulations (for example a periodical examination of the analyser).
 Please obtain the appropriate regulations from your local responsible authority.

1.5. User guideline for rechargeable batteries

NOTE

The rechargeable batterie is installed inside the analyser and is not accessible to the end customer. However, the following instructions must generally be observed when handling lithium-ion rechargeable batteries.

- ▶ The rechargeable battery can only be used in this analyser.
- Do not throw the rechargeable battery into a fire, charge it at high temperatures and store it in a hot environment.
- ▶ Do not deform, short-circuit or modify the rechargeable battery.
- ► The rechargeable battery must not be used in or under water.
- Do not expose the rechargeable battery to strong mechanical forces and do not throw it.
- Do not cut or squeeze the connecting cables of the rechargeable battery.
- ► Do not carry or store the battery together with sharp-edged objects.
- ► Do not connect the (+) contact to the (-) contact or metal.
- Non-observance of the above guidelines can cause heat, fire and explosions

2 Introduction

- This manual enables you to understand and safely operate this MRU Analyser.
- Please read this manual with great vigilant and get familiar with the product before using it.
- This Analyser may only be operated by competent personnel and for its intended use.
- Please pay special attention to all safety directions and warnings to prevent personal injuries and damaging of the product.
- We can't be held responsible for any injuries and/or damages that occur by not following the instructions in this manual.
- Always keep the manual near you when working with the analyser, to be able to read instructions as needed
- Please ensure to hand over all documents to when handing the analyser over to others.

2.1. Intended use

The analyser is intended for short-term measurements within the scope of emission measurements at small combustion plants and industrial combustion plants. The analyser measures the measurements provided by VDI4206 and EN50379 metrics and stores them for further processing.

The analyser is specifically not intended as a safety device or personal protective equipment.

The analyser should not be used as a warning device to warn people against the presence of harmful gases.

The analyser must be used according to instructions for the intended use.

Our analysers are checked according to the following regulations: **VDE 0411 (EN61010)** and **DIN VDE 0701** before they leave the MRU GmbH factory.

MRU technical products are designed and manufactured according to **DIN 31000/ VDE 1000** and **UVV = VBG 4** of the professional guilds for fine mechanics and electrical engineering.

MRU GmbH assures that the analyser complies to the essential requirements of the legal regulations of the member states of the electro-magnetic compatibility (2014/30/EU) and to the low-voltage regulations (2014/35/EU).



WARNING

Risk from manipulations to the measuring device Operational safety hazard

 Modifications or changes to the measuring device are not allowed.

2.2. About us

The analyser is produced by the MRU GmbH in Neckarsulm, Germany (Founded in 1984), a medium sized company that specializes in developing, producing and marketing high quality emission monitoring analysers.

MRU GmbH produces a wide range of instruments, from standard analysers up to tailor made industrial analysers.



Plant 1: Sales, Service, R&D



Werk 2: Production

MRU GmbH Fuchshalde 8 + 12 74172 Neckarsulm - Obereisesheim GERMANY

Fon +49 71 32 99 62 0 (Zentrale) Fon +49 71 32 99 62 61 (Kundendienst) Fax +49 71 32 99 62 20 Email: <u>info@mru.de</u> Internet: <u>www.mru.eu</u>

2.3. Packaging

Save the original carton and packing materials to prevent damage in transit in case you need to return the unit to the factory.

2.4. Return of hazardous materials

Waste Disposal/Returns/Warranty - MRU is required to accept the return of hazardous waste such as electro-chemical sensors that cannot be disposed of locally.

Hazardous waste must be returned to MRU prepaid.

2.5. Return of electronic equipment

MRU is required to accept the return, for proper disposal, of all analysers delivered after 13th of August 2005. Analysers must be returned to MRU prepaid.

3 Description

The main task of the analyser is to support the following applications:

• Exact flue gas measurements for almost all industrial combustion types

In addition, by activating appropriate options or connecting external accessories, the analyser can be used for a wide range of measuring tasks, such as

- Flow measurement
- Differential measurements of pressure and temperature

3.1. Gas flow diagram

In combination with the extraction probe (inserted in the stack) the internal gas pump of the analyser extracts a portion of the flue gas and analyses it using electro-chemical sensors.

The thermo-element in the probe tube measures the flue gas temperature and due to the construction of the probe pressure (draft) can be measured as well.



| Position | Description |
|----------|---|
| 1 | Sampling probe |
| 2 | Triple hose |
| 3 | Condensate separator |
| 4 | Star filter |
| 5 | Non return valve |
| 6 | Gas pump |
| 7 | Sensor chamber |
| 8 | O2-Sensor |
| 9 | Further electrochemical sensors optional* |
| 10 | NDIR * |
| 11 | CO Purge pump * / not available with CO2-NDIR |
| 12 | Pressure sensor * |
| | *optional |

3.2. Analyser

The analyser consists of a compact and robust glass-fiber reinforced plastic housing. All connections relevant for the measurement are located on the bottom of the analyser.





| Position | Description | Position | Description |
|----------|--|----------|--|
| 1 | Keypad | 10 | Gas outlet |
| 2 | Condensate separator | 11 | Temperature connection T1 / T-Ambient air |
| 3 | Display | 12 | Temperature connection T2 / T-gas |
| 4 | IR-Interface | 13 | Connector AUX |
| 5 | USB-Port / Charging port | 14 | Sampling probe connec- tion Condensate separator |
| 6 | SD-card reader (Only by using an MRU-SD card we can assure the com- patibility of all analyser functions | 15 | Pressure connection 1 (Differential Pressure) |
| 7 | Analyser feet | 16 | Pressure connection 2 (optional) |
| 8 | Holding magnets | 17 | Pressure connection Draft |
| 9 | Handle strip | | |



ATTENTION

Gas outlet:

During measurement the gas outlet must not be covered

3.3. Condensate seperator (water trap)



• CAUTION

Condensate is acidic

The condensate from the container can be slight acidic and can cause chemical burn.

Immediately clean with plenty of water once you have encountered acid

Condensate accumulating during the measurement is collected in the condensate separator.

Note that there are two variants of the condensate separator.

- Without water stop filter
- With water stop filter

Condensate separator without water stop filter



Remove the condensate separator by lifting it out from the groove (1) of the analyser. Then pull out the condensate separator downwards (2). Liquid discharged from the condensate separator may be slightly acidic.

Condensate vessel and plug are screwed into each other. To change the pocket star filter and dry and clean the condensate separator, it can be easily disassembled and screwed back together.

After cleaning, a leak test must be performed.

See also chapter 9.4 Performing leak test, Page 81.

An exhaust gas filter is installed in the condensate separator of the analyser. This filters out the first coarse dirt.

This pocket star filter is washable and can be used approx. 4-5 times. Frequent measurement results in a high degree of contamination, which requires regular replacement of the pocket star filter.



| Position | Description |
|----------|-------------------|
| 1 | Waters top filter |
| 2 | Sealing ring |

The water stop filter protects the analyser from moisture.

The water stop filter closes as soon as there is a risk that condensate is sucked into the analyser.

A closed water stop filter can be indicated, for example, by the fact that the flow rate is too low.

See also chapter 12Option: Monitoring flow rate, Page 91. If the flow monitoring option is installed in your analyser, the corresponding message could indicate a closed water stop filter.

- ► Check in the water stop filter
- ► Replace the water stop filter if necessary.
- Remove the condensate separator with water stop from the analyser as described above.
- ► Unscrew the condensate separator.
- ► Replace the water stop filter.

Observe the direction when installing the water stop filter

The side with the sealing ring must point upwards. Due to the arrangement of the membrane in the filter, the water stop filter will quickly become defective if inserted in the wrong direction due to excessive pressure.

The water stop filter should be replaced annually.



3.4. Extraction probes

In combination with the analyser, gas sampling probes are offered in different versions with fixed probe tube or with exchangeable probe tube. For a complete overview of accessories, see the company's current price list.

Here two variants are shown as examples:



| 1 | Probe tube | 4 | Connector for sample gas |
|---|-------------------------------|---|---------------------------------|
| | | | measurement |
| 2 | Probe cone (high grade steel) | 5 | Connector for draft measurement |
| 3 | Hose and cable routing | 6 | Connector for temperature |
| | | | measurement |

4 Operating

4.1. Display

All the information needed for the operation of the analyser can be obtained from the analyser's display, which contains the following information.



| Position | Description | | | | |
|----------|---|--|--|--|--|
| 1 | Menu bar | | | | |
| 2 | Display panel - Menu | | | | |
| | - Measurement values | | | | |
| 3 | Function key bar | | | | |
| 4 | Battery charge condition | | | | |
| 5 | SD-Card in the slot | | | | |
| | Display yellow | | | | |
| | \rightarrow write-protected \rightarrow read-only access | | | | |
| | | | | | |
| 6 | Zeroing active | | | | |

4.2. Keypad

Description of the keys and their functions:

| Кеу | Function |
|-------------------------------------|--|
| ON/OFF Function keys F1 F2 F3 | A short press switches the analyser on without delay. Switching off the device is delayed to protect the sen- sor when no ambient air is present. Then purging is recommended before switching off. Activates the function that is shown in the function key bar on the display. |
| Menu Key ••• ESC | Will show all available functions in the window that is currently in use – also those which have an individual key on the key pad like the printer and the three function keys. Abort or return to the |
| ESC | |
| Arrow keys | Move cursor, change values |
| ок ОК | Confirmation key, selection of the marked menu item |
| Printer | Activates the printer func- tion in the measurement and service window |

4.3. Menu structure

The analyser organizes all available actions into three main menus:

Menu Measurement

Here you will find all actions for the measuring tasks of the analyser. In particular, all installed measuring tasks are listed here and can be selected.

Menu Storage

All available storage options will be displayed and can be selected here.

• Menu Extra

All other actions are available here to manage and customize the analyser.



You can jump in between the 3 main menus with the 3 function keys (according to the displayed name on the screen).

5 First usage

After ensuring that the analyser is ready for operation, you can make some customer-specific adjustments during the initial startup. All settings can be changed at any time later.

5.1. Preparatory steps

- ► Unpack the analyser.
- ▶ Read the User Manual completely.
- The analyser leaves the factory assembled and ready for use. Nevertheless, check the device for completeness and integrity.
- ► Charge the battery of the analyser for about 8 hours.
- Check date and time. Modify if needed.

5.2. Customize settings

| Measurement menu |) | Extras menu | , | Settings | | | Settings | |
|-------------------------|----|--------------------------|----|--------------------------------|---|--------------|-------------------------|---------|
| Gas measurements | | Settings | | LCD brightness (%) 50 | | | LCD brightness (%) | 100 |
| Pressure measurement | | Date & time | | Country USA/intern. | 1 | | Country USA/ | intern. |
| Diff. temp. measurement | | Service menu | | Language English | 1 | | Language E | Inglish |
| Last measured values | | Default settings | | LED condensate trap 50% | | | LED condensate trap | 50% |
| 400DH (ext. Sonde) | | Service values | | Helpful hints ON | 1 | | Helpful hints | ON |
| Zeroing | | Leak proof test | | Font Standard | 1 | | Font Sta | andard |
| | | Contents SD card | | Cursor colour Standard | 1 | | Cursor colour Sta | andard |
| | | Device info | | Power-ON protection OFF | 1 | | Power-ON protection | OFF |
| | | | | Keyboard beep OFF | | | Keyboard beep | OFF |
| | E3 | | ov | | | | • | |
| start storage extras | FJ | measure storage settings | UN | print-out Bluetooth easurement | | \mathbf{T} | print-out Bluetooth eas | urement |

Press F3.

- \Rightarrow The Extras menu appears.
- ► Select Settings.
- ► Press OK.
 - \Rightarrow The menu Settings appears.
- ► Select the desired setting.
- ► Change the desired setting.
- ► Press ESC.
 - \Rightarrow The change is saved.
 - ⇒ The Extras menu appears.

In the "Settings" menu you can make the following customizations:

| Setting | Range | Description |
|---------------------|----------------|--|
| LCD brightness | 5 – 100 % | Setting the display contrast |
| Country | Option | By switching the country, |
| | | the set O2 reference values |
| | | are lost. |
| | | The fuel list is |
| | | reset. Country-specific de- |
| | | fault settings and measur- |
| | | ing procedures are also set. |
| Language | Option | Selection of the analyser |
| | | language |
| LED condensate trap | OFF, 50%, 100% | Change the brightness of |
| | | the condensate trap LED |
| Helpful hints | ON / OFF | Some helpful hints which are very useful for an inex- perienced user but are not needed by experienced users, can be activated or deactivated. The following hints will be affected: "Zeroing finished, Sensors are ready. Analyser ready for measurement." "Reminder! Charge batter- ies at regular intervals!" "Measurement stopped/started." |
| Font | | Change font. You can choose between Standard and Extra. |
| Cursor colour | | Change cursor colour. You can choose between Standard, Eye-Catching and Colour filled. |
| Power-ON protection | ON / OFF | If you have activated the power-on protection and press the ON key, the dis- play will show a a 20-second countdown. Press F2 to turn the ana- lyser on. |
| Keyboard beep | ON / OFF | Set signal tone when key is pressed |
| 400 DH (ext. Sonde) | ON / OFF | Activation of the external probe 400 DH |

5.3. Export and import settings

You have the possibility to export saved settings to an SD card and import these settings to another analyser.

Export user settings

| Settings | | Settings | |
|--------------------------------|-----|-------------------------------|---|
| LCD brightness (%) 50 | | Country USA/intern. | |
| Country USA/intern. | | Language English | |
| Language English | | print-out (F1) | |
| LED condensate trap 50% | | Bluetooth (F2) | |
| Helpful hints ON | | measurement (F3) | |
| Font Standard | | Import user settings | |
| Cursor colour Standard | | Export user settings | |
| Power-ON protection OFF | | Extras menu (Esc) | |
| Keyboard beep OFF | | 400DH (ext. Sonde) ON | |
| print-out Bluetooth easurement | ••• | print-out Bluetooth measureme | 0 |

- ► Make sure that there is an SD card in the analyser.
- ► Go to the menu Settings.
 - See also chapter 5.2 Customize settings, Page 23.
- ▶ Press the menu key.
 - \Rightarrow A selection list appears.
- ► Select Export user settings.
- ▶ Press OK.
 - \Rightarrow The settings are exported to the SD card.
 - ⇒ The settings are saved on the SD card as SETTINGS.USR

Import user settings

| Settings | | Settings | |
|-------------------------------|-----|----------------------|--------------|
| LCD brightness (%) 50 | | Country | USA/intern |
| Country USA/intern. | | Language | English |
| Language English | | print-out (F1) | |
| LED condensate trap 50% | | Bluetooth (F2) | |
| Helpful hints ON | | measurement (F3) | |
| Font Standard | | Import user settings | |
| Cursor colour Standard | | Export user settings | |
| Power-ON protection OFF | | | |
| Keyboard beep OFF | | 400DH (ext. Sond | e) ON |
| Fint-out Bluetooth easurement | ••• | print-out Bluetoot | th measureme |

- Insert the SD card with the exported settings into the desired analyser.
- ► Go to the menu Settings.
 - See also chapter 5.2 Customize settings, Page 23.
- ▶ Press the menu key.
 - \Rightarrow A selection list appears.
- Select Import user settings.
- ▶ Press OK.
 - \Rightarrow The settings are imported.

5.4. Set measurement

| Settings | 0 | Measurement settings | | | | Measurement settings | | |
|------------------------------|------|----------------------|---------|---|---|----------------------|---------|----|
| LCD brightness (%) 5 | D | Temperature unit | ۴ | | | Temperature unit | °C | |
| Country USA/inter | 1. | Diff.press. unit | Pa | | | Diff.press. unit | Pa | |
| Language Englis | h | Draft unit | inchH20 | | | Draft unit | inchH20 | |
| LED condensate trap 50 | 6 | Unit for P-abs. | inchH20 | | | Unit for P-abs. | inchH20 | |
| Helpful hints 0 | N | Mass flow | mg/s | | | Mass flow | mg/s | |
| Font Standa | d | Unit density | mg/m³ | | | Unit density | mg/m³ | |
| Cursor colour Standar | d | Mass/Energy | mg/MJ | | | Mass/Energy | mg/MJ | |
| Power-ON protection OF | F | Mass/Capacity | mg/kWh | | | Mass/Capacity | mg/kWh | |
| Keyboard beep OF | F | Factor NO to NOx | 1.05 | | • | Factor NO to NOx | 1.05 | |
| print-out Bluetooth easureme | " F3 | • | | ▼ | | - | | ES |

- ► Go to the menu Settings.
 - See also chapter 5.2 Customize settings, Page 23.
- Press F3.
 - ⇒ The menu Measurement settings appears.
- Select the desired setting.
- Change the desired setting.
- ► Press ESC.
 - \Rightarrow The change is saved.
 - \Rightarrow The menu Settings appears.

In the menu "Measurement settings" menu you can make the following customizations:

| Setting | Range | Description |
|------------------------|---|--|
| Temperature unit | °C, °F | Select temperature unit |
| Diff. press. unit | hPa/Pa, hPa, kPa/Pa, kPa, mbar, mmH2O, cmH20, inchH2O, mmHG, inHg, PSI, bar, MPa Pa | Select pressure unit |
| Draft unit | hPa/Pa, hPa, kPa/Pa, kPa, mbar, mmH20, cmH20, inchH20, mmHG, inHG, PSI, bar, MPa, Pa, | Select draft unit |
| Unit for P-abs. | hPa, KPa/Pa, kPa, mbar, mH2O, cmH2O, inchH2O, mmHG, inHG, PSI, bar,MPa, Pa | Select unit for P-abs. |
| Mass flow | mg/s,lb/yr,Tpy, | Select unit for Mass flow |
| Unit density | mg/m³, grain/ft³ | Select Unit density |
| Mass/Energy | mg/MJ, lb/MMBtu | Select unit for Mass/ Energy |
| Mass/Capacity | mg/kWh, g/bhp-hr | Select unit for Mass/Capacity |
| Factor NO zu NOx | 1.00 – 2.00 | Enter factor for conversion from NO to NOx. |
| O2 resolution | 0.1%, 0.01% | Enter value for O2 resolution |
| Core flow search | ON / OFF | Core flow search before start of each gas measurement: activated or deactivated |
| Add soot&T-boiler | ON / OFF | Add soot and T-boiler after each gas measurement: activated or deactivated |
| Annular -gap test | ON / OFF | Annular gap test: activated or deactivated |
| Combustion calculation | ON / OFF | If the combustion calculation is switched off following items will be changed: - no fuel types, respectively always "Sample Gas" |
| | | - no measuring values losses, ETA, ETAcond, Dev. point |
| | | no measuring value CO2, except it will be measured |
| | | no measuring values CO/NO/,,,. in [mg/kWh]/[mg/MJ] no fuel type will be shown on the menu bar and print-out |
| QR-Code | QR-ZIV / QR-4u | Selection of the created QR code for ZIV or QR-4u (App.) |

5.5. Set Bluetooth parameters

Depending on the features, the analyser can be used to exchange measurement data wirelessly with external devices:

- With MRU4U (App for Android and iOS Smartphones)
- With MRU4Win
- With MRU Bluetooth-Printer

Depending on the software version of the danalyser and the technical realization of the Bluetooth interface, settings for data transfer may be required.

▶ Please check in the following menu:

| Settings | | | Bluetooth | |
|-------------------------|----------|----|-------------------------|---|
| LCD brightness (%) | 50 | | DUAL MODE (Android/iOS) | } |
| Country USA | /intern. | | | |
| Language | English | | | |
| LED condensate trap | 50% | | | |
| Helpful hints | ON | | | |
| Font St | tandard | | | |
| Cursor colour St | andard | | | |
| Power-ON protection | OFF | | | |
| Keyboard beep | OFF | | | |
| print-out Bluetooth eas | surement | F2 | return | |

- ► Go to the menu Settings.
 - See also chapter 5.2 Customize settings, Page 23.
- ▶ Press F2.
 - \Rightarrow The menu Bluetooth appears.

If "DUAL MODE (ANDROID/IOS)" appears in the settings window, the Bluetooth module supports all applications without any further settings.

If "DUAL MODE (ANDROID/IOS)" appears in the settings window instead of "ANDROID/IOS", a settings window appears in which you can select between the ANDROID/IOS modes, select whether you want to connect the analyser to an Android or iOS smartphone. A connection to the Bluetooth printer or to MRU4WIn is realized with the "ANDROID" setting.

5.6. Setting date and time

If the built-in rechargeable battery is completely discharged, a new setting of these values is required

| Measurement menu | P | | Extras menu | | | Date & time | | | Set clock | P 🕞 | |
|------------------------|--------|----|------------------|----------|----|-------------|----------------|---------------|-----------|------------------------|----|
| Gas measurements | | | Settings | | | | | | | | |
| Pressure measurement | | | Date & time | | | Date | WED 10/20/2021 | | Date | WED 10/20/2021 | |
| Diff. temp. measuremen | nt | | Service menu | | | | | | bate | 1120 10/20/2021 | |
| Last measured values | | | Default settings | | | | | | | | |
| 400DH (ext. Sonde) | | | Service values | | | Time | 08:43:10 | | Time | 09:39 <mark>:29</mark> | |
| Zeroing | | | Leak proof test | | | | | | | | |
| | | | Contents SD card | | | | | | | | |
| | | | Device info | | | | | | | | |
| | _ | | | | | | | | 1 | | |
| start storage e | extras | F3 | measure storage | settings | OK | | modify | F2 F 2 | | store | F2 |

- ▶ Press F3.
 - \Rightarrow The Extra menu appears.
- ► Select Date / Time.
- ▶ Press OK.
 - ⇒ The menu Date/Time appears.
- Press F2.
 - ⇒ The menu Set clock appears.
- Set the desired Date
- Set the desired Time.
- Press F2.
 - \Rightarrow The change is saved.

5.7.Configure measurement program

For each of the programs the following parameters can be configured:

- CO ppm limit: adjustable value for the CO sensor protection. If the CO value in the flue gas is higher than the adjusted value in the analyser, the purge pump will be activated and the sensor will be protected against high CO concentrations. (Optional)
- 2. Selectable fuel types: choose and select from the available fuel type list
- 3. Measurement windows: configuration of what and where will be displayed in the 3 measurement value windows.
- 4. Zoom window: select what will be displayed in the zoom window
- 5. Program name

The following program is pre-configured:

"Test Program" indented for use at instrument maintenance and calibration.

5.8. Set CO-Limit

| Measurement menu | | Selection meas.program | | | CO-Limit | , | | CO-Limit | |
|-------------------------|----|------------------------|----------|----|----------------|-----|---------------------|----------------|-------|
| Gas measurements | | Program 1 | | | | | | | |
| Pressure measurement | | Program 2 | | | Program 1 | | | Program 1 | |
| Diff. temp. measurement | | Program 3 | | | CO-limit [ppm] | 100 | | CO-limit [ppm] | 20000 |
| Last measured values | | Program 4 | | | | | | | |
| 400DH (ext. Sonde) | | Annular-gap test | | | | | | | |
| Zeroing | | Test program | | | | | | | |
| | | | | | | | | | |
| | | | | | | | | | |
| | | | _ | | | | | 1 | |
| start storage extras | OK | CO-Limit p | org.name | F1 | | | ▼ | | |

- Select Gas measurements.
- ▶ Press OK.
 - ⇒ The menu Selection meas. program appears.
- Select the desired measuring program from which the CO limit value is to be set
- ▶ Press F1.
 - \Rightarrow The menu Co-Limit appears.
- Set the desired CO-limit [ppm].
- ► Press OK.
 - ⇒ The desired CO-limit [ppm] is stored.

5.9. Change measurement program name

You have the possibility to change the name of the measurement program.



- Select Gas measurements
- Press OK.
 - \Rightarrow The menu Selection meas. program appears.
- Press F3.
- Change the name of the measurement program to your needs.
- Press OK.
 - ⇒ The changed name is displayed in the menu Selection meas. program.

MRU GmbH, D-74172 Neckarsulm

5.10. Select fuel types and O₂ reference



Note that you can only select the Fuel type selection if the combustion calculation has been switched on.

NOTE

See also chapter 5.4 Set measurement, Page 26

Each time a measuring program for flue gas measurement is called up, a fuel can be selected from a list. Which fuel is available for selection can be selected from a fuel type list.

Add fuels to fuel type selection

| Measurement menu 🛛 👂 📭 | | Selection meas.program | | Fuel type selection | | Fuel type list | • | Fuel type list | 7 |
|-------------------------|----|------------------------|----|---------------------|----|----------------------------|-------------------------------------|----------------|----|
| Gas measurements | | Program 1 | | Natural gas | | Sample gas | | Sample gas | |
| Pressure measurement | | Program 2 | | Propane | | Natural gas | | Natural gas | 1 |
| Diff. temp. measurement | | Program 3 | | Butane | | Propane | | Propane | 1 |
| Last measured values | | Program 4 | | Oil light #2 | | Butane | | Butane | 1 |
| 400DH (ext. Sonde) | | Test program | | Oil light #5 | | Oil light #2 | | Oil light #2 | 1 |
| Zeroing | | | | Oil light #6 | | 🗸 Oil light #5 | | √ Oil light #5 | 1 |
| | | | | Kerosine | | 🗸 Oil light #6 | | √ Oil light #6 | 1 |
| | | | | Distillate #1 | | Oil heavy | | Oil heavy | 1 |
| | | | | Diesel | 1 | / Kerosine | | / Kerosine | 1 |
| start storage extras | 0K | CO-Limit prg.name | OK | ▼ fuel type list | F2 | ▼ insert return 02 ref. | Program 1 Produced System Annual | | F2 |

- ► Select Gas measurements.
- ► Press OK.
 - ⇒ The menu Selection meas. Program appears.
- ▶ Select the desired measurement program.
- ► Press OK.
 - \Rightarrow The menu fuel type selection appears.
- Press F2.
 - \Rightarrow The menu Fuel type list appears.
- Select the fuel which should be added to the menu Fuel type selection.
- ▶ Press F1.
 - \Rightarrow The selected fuel is marked with a check mark.
- ► Select other fuels if necessary.
- ▶ Press OK.
 - \Rightarrow The selected fuels are displayed in the menu Fuel type selection.

Set O2-reference

| Fuel type list | | | Info fuel type | | | | | Info fuel type | | |
|----------------|---------|----|----------------|--------|---|-------|---|----------------|--------|----|
| / Sample gas | | | Sample gas | | | | | Sample gas | | |
| Natural gas | | | | | | | | 1.000 | | |
| Propane | | | 02ref [%] | 1 | | | | 02ref [%] | 20 | |
| Butane | | | CO2max [%] | 0.0 | | | | CO2max [%] | 0.0 | |
| Oil light #2 | | | A2 | 0.0000 | | | | A2 | 0.0000 | |
| √ Oil light #5 | | | В | 0.0000 | | | | В | 0.0000 | |
| 🗸 Oil light #6 | | | Fw | 0 | | | | Fw | 0 | |
| Oil heavy | | | kWh-factor | 0.0000 | г | | | kWh-factor | 0.0000 | |
| 🗸 Kerosine | | | BW-factor | 1.000 | | | _ | BW-factor | 1.000 | |
| delete return | 02 ref. | F3 | standard | | • | ▼ | | standard | | 0K |

- ► Go the menu Fuel type list.
 - See also chapter Add fuels to fuel type selection, Page 31.
- ► Select the desired fuel.
- Press F3.
 - \Rightarrow The menu Info fuel type appears.
- Stellen Sie den gewünschten O2-Bezug ein.
- ► Set the desired O2-reference
- Press OK.
 - \Rightarrow The set O2 reference is saved.

5.11. Define user fuel type



You can define four fuels to your individual needs.

You can define the name and the fuel parameters.

Like the other fuels, you can add user fuels to the menu Fuel type selection.

| - | |
|---|-----|
| | |
| | - 1 |

The last 4 fuels in the menu Fuel type list are the user fuels. The user fuels are indicated in the menu Fuel Type list in green colour.

NOTE

| Fuel type list | | Define user fuel type | P 🕞 | | Define user fuel type | Define user fuel type |
|-------------------|--------------------|-----------------------|------------|----|---|---|
| / Wood 10%M. | | 1. user fuel type | | | 1. user fuel type | |
| Vood 20%M. | | 00 (1%) | | | 1. user tuel type $1. 1 2 3 4 5 6 7 8 9 1$ | 0 1 2 3 4 5 6 7 8 9 |
| / Wood 30%M. | | 02ref [%] | 12.0 | | ! # & A B C D E F G | ! |
| √ Pellets | | A2 | 0.60 | | H I J K L M N O P Q | H I J K L M N O P Q R S T II V W X Y Z A |
| 1. user fuel type | | В | 0.000 | | bcdefahiik | bcdefghijk |
| 2. user fuel type | | Fw | 0 | | lmnopqrstu | lmnopqrstu |
| 3. user fuel type | | kWh-factor | 0.0000 | | v w x y z () * + , | v w x y z () * + , |
| 4. user fuel type | | BW-factor | 1.012 | | / : % = ? [] | / : % = ? [] |
| insert return def | _{fine} F3 | fuel name standard | | F1 | {} _^ ° @ ' < > ~ delete insert setchar. OK ▼ F2 | {}_^ @'<>~ delete insert set char. |

- ► Go the menu Fuel type list.
 - See also chapter Add fuels to fuel type selection, Page 31.
- Select the user fuel type you want to define.
- ► Press F3.
 - \Rightarrow The menu Define user fuel type appears.
- Press F1.
 - \Rightarrow A window appears.
- ► Change the name of the user fuel type to your needs.
- ▶ Press OK.
 - \Rightarrow The changed name is displayed in the menu Define user fuel type.
 - ⇒ After you have changed the name of the user fuel, you can define the fuel parameters.

| Define user fuel type | , | | | | Define user fuel type | | | Fuel type list |
|-----------------------|--------|---|-------------------|---|-----------------------|--------|----|----------------------|
| EXAMPLE FUEL | | | | | EXAMPLE FUEL | | | / Wood 10%M. |
| | | | | | | | | Vood 20%M. |
| 02ref [%] | 0 | | | | 02ref [%] | 5 | | Vood 30%M. |
| CO2max [%] | 12.0 | | | | CO2max [%] | 13.6 | | Vood 40%M. |
| A2 | 0.60 | | | | A2 | 0.60 | | / Pellets |
| В | 0.000 | | | | В | 0.022 | | EXAMPLE FUEL |
| Fw | 0 | | | | Fw | 10 | | 2. user fuel type |
| kWh-factor | 0.0000 | | | - | kWh-factor | 0.0000 | | 3. user fuel type |
| BW-factor | 1.012 | | | | BW-factor | 1.012 | | 4. user fuel type |
| | | ◀ | | | | | ov | |
| fuel name standard | | | $\mathbf{\nabla}$ | | standard | | UN | insert return define |

- Select the desired fuel parameter.
- Change the desired fuel parameter.
- ► Press OK.
 - \Rightarrow The defined user fuel appears in the menu Fuel type list.
 - ⇒ You can add the defined user fuel to the menu Fuel type selection.
 - See also chapter Add fuels to fuel type selection, Page 31.

5.12. Define measurement window.



- Start a measuring program.
 In this example Program 1, Sample gas.
- Select one of three measurement windows.
- Press the menu key
 - \Rightarrow A selection list appears.
- ► Select Define measuring window.
- Press OK.

⇒ The measurement window appears

- Select the desired measured value that you want to change.
- Press the menu key.
 - \Rightarrow A selection list appears.
- ► Select Save measuring window.
- ► Press OK.
 - \Rightarrow The change is saved.

5.13. Configure zoom window

In each measuring program, a zoom window is available for the enlarged display of measured values.

You can choose between two zoom views.

- Press the arrow key at the top to display four measured values with the respective curve. The scaling is automatic. The x-axis shows the last 150 seconds
- Press the down arrow key to display two measured values without a curve.

The following example shows the configuration of the zoom window with four measured values. The configuration of the zoom window with two measured values is done in the same way.



- Start a measuring program.
 In this example Program 1, Sample gas.
- ▶ Press the arrow key up.
 - \Rightarrow The zoom window appears.
- Press the menu key.
 - \Rightarrow A selection list appears.
- ► Select define measuring window.
- Press OK.
- Select the desired measured value that you want to change.
- ▶ Press the menu key.
 - \Rightarrow A selection list appears.
- Select Save measuring window.
- ► Press OK.
 - \Rightarrow The change is saved.

6 Prepare measurement

6.1. Perform overall visual inspection

Before using the analyser, perform an overall visual inspection to ensure that the analyser is operating correctly.

6.2. Ensure power supply

The analyser can be used with:

- with the internal MRU battery (provided)
- with the MRU battery charger (provided)

External equipment may only be connected while the analyser is switched off!

6.3. Automatic Auto-off function

The auto-off function switches the analyser off after 60 minutes without any key operation.

The auto-off function is deactivated during a measurement or the charger/USB connection, the auto-off function is deactivated.

6.4. Measuring with grid power supply / Battery charging

Whenever you connect the analyser with external battery charger (90...260 V / 50/ 60Hz) the battery will be charged Once the battery is fully charged the analyser will switch to trickle charge mode.

6.5. Measurements in battery mode (battery monitoring)

The battery symbol in the top right corner displays the current battery charge condition.

Approximately 15 minutes (depending on the analyser configuration) before the battery is drained, the battery symbol will start to blink red (about once per second).

When the battery is almost drained and the analyser is not connected to the battery charger within one minute, then the analyser will switch off automatically to prevent deep discharge of the battery.
6.6. Operating temperature

If the analyser has been stored at low temperatures, it will require some time to equilibrate to the ambient temperature before being switched on. If it does not equilibrate, condensation will occur inside the analyser! If the temperature is out of its operation range you will see messages on the display:

ATTENTION

Once one of these messages appears you will not be able to use the analyser, it will give an acoustic signal until it has reached the specified operation temperature between $+5^{\circ}C$ and $+45^{\circ}C$

6.7. Control Condensate separator

▲ CAUTION



Acid burns may result from weakly acidic liquids from the condensate.

- If you come into contact with acid, wash the area immediately using a lot of water.
- Control the condensate separator before and after each measurement

Acid from the condensate

- Check that the condensate separator is empty.
- Check the star filter.
 - \Rightarrow Star filter white = ready for use
 - ⇒ Star filter dark = renew

When switching off, a warning message is displayed:

6.8. Connections and tightness

Check all plug connections for correct fitting.

Check all hoses, hose connections, condensate containers (from the probe tip to the gas connection on the analyser) for tightness. The analyser has a built-in automatic test to check the tightness of the gas paths.

See also chapter 9.4 Performing leak test, Page 81

| 6.9. Automati | c zero point | |
|------------------------|-----------------------------------|-----------------------------|
| Measurement menu | Measurement menu | Measurement menu 🛛 🗾 💭 |
| G | Gas measurements | Gas measurements |
| PI ATTENTION ! | Pressure measurement | Pressure measurement |
| D Start of zeroing | Diff. temp. measurement | Diff. temp. measurement |
| L | Last measured values | Last measured values |
| 4 The probe has to | 400DH (ext. Sonde) | 400DH (ext. Sonde) |
| z stay in ambient air! | Zeroing | Zeroing |
| storage extras | storage extras | storage extras |
| | | NOTE |
| i | The probe must not be in zeroing. | n the exhaust gas during th |

- Switch on the analyser.
 - ⇒ The analyser autonomously carries out a zero-point measurement.
 - ⇒ During zeroing, the -> 0.0 <- symbol flashes in the upper right corner of the display.
 - ⇒ After zeroing is complete, the analyser is ready for measurement.
 - ⇒ If sensors are faulty, the error is identified during zeroing and an error message is displayed.

Repeat zeroing

The zeroing can be repeated at any time as long as the probe is not inside the stack

| Gas measurements | | G | |
|-------------------------|----|----|----------------------|
| Pressure measurement | | Р | ATTENTION ! |
| Diff. temp. measurement | | D | Start of zeroing |
| Last measured values | | La | j |
| 400DH (ext. Sonde) | | 4 | The probe has to |
| Zeroing | | z | stay in ambient air! |
| | | | |
| | | | |
| | OK | | |
| storage extras | UN | | storage extras |

- ► Go to the Measurement menu
- Select Zeroing
- Press OK.
 - \Rightarrow Zeroing is started.

7 Performing measurement

In the basic configuration, each analyser has the complete functionality you need for gas measurement.

The process of gas measurement is described below.

The description of other optionally available measuring programs can be found in the appendix or on separate supplementary sheets.

7.1. Perform Gas measurement

Core flow search



You can preselect whether a core flow search is to be carried out in the measuring programs before the start of the measurements.

The core flow search will help you to find the optimal measurement point in the stack. The core flow can be identified by the maximum flue gas temperature. In high reaction time the analyser displays the trend of the flue gas temperature. Insert the probe pipe slowly into the stack and position your probe tube when you have reached the maximum flue gas temperature that is displayed

Positioning the probe in the core flow:

Insert the probe pipe slowly into the stack and position your probe pipe when you have reached the maximum flue gas temperature that is displayed.

Maximum temperature has been reached when the arrows (left picture) disappear, max. (Right picture) appears in place of the arrow, and the beeper signal stops. Moving away from the max. Temperature will result in the bars moving away from the max. Once the right core flow has been achieved, the probe is fixed with the probe cone screw.

Select Measurement program

DANGER

Rick due to toxic gases



There is a risk of poisoning.

Noxious gases are sucked in by the measuring device and released into the ambient air.

 Only use the measuring device in well ventilated spaces.

NOTE

Wrong measuring results



The extracted flue gas must be able to evacuate the analyser without obstruction.

The exhaust outlet at the rear of the analyser may never be covered during a measurement, never operate the analyser in a transport case.

| Measurement menu | | Selection meas.program | , | | Fuel type selection | I | | Core flow search | | | Program 1, Natur | al gas 🛛 🔋 🗔 |
|-------------------------|-------|------------------------|----------|----|---------------------|----------|------|------------------|---------|----|------------------|-----------------|
| | | | | | | | | MAX °F | CURRENT | | T-gas | 79.0 |
| Gas measurements | | Program 1 | | | Natural gas | | | 075 | | | F | |
| Pressure measurement | | Program 2 | | | Propane | | | 9/ | 105 | | °F | 77.5 |
| Diff. temp. measurement | | Program 3 | | | Butane | | | | 05 | | C02 | 0.0 |
| Last measured values | | Program 4 | | | Oil light #2 | | | | | | % | 0.0 |
| 400DH (ext. Sonde) | | Test program | | | Oil light #5 | | | - | | | °F | 32.0 |
| Zeroing | | | | | Oil light #6 | | | | | | 02 | 20.0 |
| | | | | | Kerosine | | | | | | % | 20.9 |
| | | | | | Distillate #1 | | | | | | Draft inchH2O | -0.001 |
| | | | | | Diesel | | | - | - | | CO | 0 |
| | OK | | | ٥ĸ | • | (| าห 🎚 | - | - | E1 | ppm | U |
| start storage extra | as UN | CO-Limit | prg.name | UN | fuel type list | L L | JN | forward | | ГІ | stop st | tore >clipboard |

- ► Go to the Measurement menu.
- Select Gas measurements.
- Press OK.
 - ⇒ The menu Selection meas. program appears.
- Select the desired measurement program.
- ▶ If necessary, change the CO-Limit.
 - See also chapter 5.8 Set CO-Limit, Page 30.
- ▶ If necessary, change the measurement program name.
 - See also chapter 5.9Change measurement program name, Page 30.
- ▶ Press OK.
 - \Rightarrow The menu Fuel type selection appears.
- ► Select the desired fuel.
- If necessary, add fuels from the fuel type list to the menu Fuel type selection.
 - See also chapter Add fuels to fuel type selection, Page 31.
- ▶ Press OK.
 - \Rightarrow If activated the menu Core flow search appears.
- ▶ Perform the Core flow search and then press F1.
 - See also chapter Core flow search, Page 39.
 - \Rightarrow The Measurement is started.

NOTE

 \Rightarrow If activated, the menu Core flow search appears.

You can start a measurement with the previously set measurement parameters directly from the Measurement menu.

- ► Press F1.
- 1
- 79.0 T-air 77.5 85 Diff. temp. measureme C02 0.0 Dewp 00DH (ext. Sonde) 32.0 20.9 Draft inchi 120 0.001 CO ppm 0 F1 F1

 \Rightarrow The Measurement is started.

Measurement window

The measured values are organised in three windows of 7 measured values each.

Which measured value is displayed at which position in the window is configurable.

See also Chapter 5.12, Page 34 and chapter 5.13Configure zoom window, Page 35.

Direct measured variables such as oxygen content or temperature are available as measured values, as are calculated values such as dew point, CO2 content, etc. The same measured value is also available in different conversions, such as CO as ppm or mg/kWh. Measured values that are not available are shown as dashes. Reasons for unavailability can be:

- Electrochemical sensor was detected as faulty during zeroing.
- External temperature sensors are not plugged in.

The measured value T-gas is primarily derived from the connection "T-gas / AUX" (depending on the equipment) or, if not available, from the connection "T1".

CO purging

If the configured CO threshold is exceeded during the gas measurement, the analyser activates the purge function. This protects the CO sensor from excessive CO values without falsifying other measured values.

During the purging, the CO measured value has no meaning and is therefore replaced by dashes. These are red as long as the CO measured value is still above the set CO threshold and then turn black when purging is successful.

Purging does not end automatically, but must be switched off by the user.

To do this, select the menu key and the subitem "purge pump OFF"

7.2. Performing measurements with measurement assistant

With the help of the measurement assistant, you can collect several individual measurements. You can export the collected measurements via Bluetooth or QR code to the app MRU4u (or other management programmes) and/or print them out. The printout can be viewed in a preview printout.

Switch on the measurement assistant

Before you can use the measurement assistant, you have to switch on the measurement assistant in the menu Setting Measurement.

- ► Go to the menu Measurement settings.
 - See also chapter 5.4 Set measurement, Page 26.

| Measurement settings | , | | Measurement settings | , |
|----------------------|-----------|-----------|----------------------|-----------|
| • | | | • | |
| Mass flow | lb/yr | | Mass flow | lb/yr |
| Unit density | grain/ft³ | | Unit density | grain/ft³ |
| Mass/Energy | mg/MJ | | Mass/Energy | mg/MJ |
| Mass/Capacity | mg/kWh | | Mass/Capacity | mg/kWh |
| Factor NO to NOx | 1.05 | | Factor NO to NOx | 1.05 |
| Core flow search | ON | | Core flow search | ON |
| Add soot&T-boiler | ON | | Add soot&T-boiler | ON |
| Annular-gap test | ON | | Annular-gap test | ON |
| assist | OFF | | assist | ON |
| | | | | |
| | | \bullet | | |

- ► Select assist.
- Switch on assist.

Use templates

If you have switched on the measurement assistant, you can select specific templates in the Menu Selection meas. program to adapt this meu to your needs.

| Measurement menu | | Selection meas.program | | Selection meas.program 🛛 👂 📼 |
|--------------------------|----|------------------------|-----|------------------------------|
| Gas measurements | | Annular-gap test | | Annular-gap test |
| Particul. matter measur. | | Program 2 | | Program 2 |
| Determine Humidity | | Program 1 | | Program 1 |
| Ambient CO Test | | Program 3 | | Fuel type selection (OK) |
| Test 4-/8-Pa | | Program 4 | | Template 1 |
| Pressure measurement | | Solid fuel measurement | | Measurement menu (Esc) |
| Let by and tightness | | Test program | | ····· |
| Gas flow measurement | | | | |
| AUX-Anemometer | | | | |
| start storage extras | OK | | ••• | |

- ► Go to the Measurement menu.
- Press OK.
 - ⇒ The menu Selection meas. program appears.
- ▶ Press the menu key.
 - \Rightarrow A selection list appears.
- Select the desired template.
- ► Press OK.
 - \Rightarrow The menu changes accordingly.

Collect measurement

After you have activated the measurement assistant, you can select and "collect" the desired measurements.

| Measurement menu | | Selection meas.program | • | Fuel type selection | • | Annular-gap test 🛛 📕 📼 | | assist 🛛 🔎 📼 |
|--------------------------|----|------------------------|----|---------------------|----|------------------------|----|------------------------|
| Gas measurements | | Annular-gap test | | Natural gas | | already measured | | T-boiler |
| Particul. matter measur. | | Program 2 | | Propane | | ⁰² 20.92 | | Annular-gap test 🛛 🖌 |
| Determine Humidity | | Program 1 | | Butane | | CO O | | Program 2 |
| Test 4-/8-Pa | | Program 3 | | Oil light #2 | | ppm U | | Program 1 |
| Pressure measurement | | Program 4 | | Oil light #5 | | | | Program 3 |
| Let by and tightness | | Solid fuel measurement | | Oil light #6 | | ourrently measured | | Program 4 |
| Gas flow measurement | | Test program | | Kerosine | | currentry measured | | Solid fuel measurement |
| AUX-Anemometer | | | | Distillate #1 | | Pa -1 | | |
| AUX-Humidity | | | | Diesel | | | | |
| • | OK | | OK | - | OK | °C Z3.4 | F2 | |
| start storage extras | | | | fuel type list | | stop collect 02/C0 | 12 | preview QR-4u Deletem. |

- ► Go to the Measurement menu.
- ► Select Gas measurements.
- Press OK.
 - ⇒ The menu Selection meas. program appears.
- ► If necessary, select a desired template.
 - See also chapter Use templates, Page 43.
- Select the desired measurement program. In this example, an Annular-gap test, a Program 2 and a Program 1 measurement are collected.
- Select Annular-gap test.
- Press OK.
 - \Rightarrow The menu Fuel type selection appears.
- ► Select the desired fuel.
- If necessary, add fuels from the fuel type list to the menu fuel type selection.



Users who start with the Annular-gap test first can select a fuel when selecting the Annular-gap test. This fuel is then also used for the following measurements (e.g. Program 2, Program 1).

NOTE

- See also chapter Add fuels to fuel type selection, Page 31.
- ► Press OK.
 - ⇒ The Annular-gap test starts.
- ▶ Perform the Annular-gap test.
- ▶ Press F2 after you have finished the Annular-gap test.
 - \Rightarrow The menu assist appears.
 - ⇒ The Annular-gap test is collected in the measurement assistant.

| assist 🛛 🔎 📼 | | Core flow search | | Program 2, Natural gas 🛛 🖉 📟 | | assist 🍡 📕 📟 |
|------------------------|----|------------------|----|------------------------------|----|------------------------|
| T-boiler | | | | co ppm/ref0%02 0 | | T-boiler |
| Annular-gap test 🖌 | | /0 /0 | | ^{I-air} 78.0 | | Annular-gap test 🖌 |
| Program 2 | | | | co n | | Program 2 🖌 🖌 |
| Program 1 | | | | ppm U | | Program 1 |
| Program 3 | | | | Air ratio | | Program 3 |
| Program 4 | | | | Eff. ncv | | Program 4 |
| Solid fuel measurement | | | | % • | | Solid fuel measurement |
| | | | | ⁰² 21.0 | | |
| provinu OP 4u Dolato m | OK | ferward | F1 | Exc.Air | F2 | provious OB 4u Delatem |

- Select Program 2
- Press OK.
 - \Rightarrow If activated, the core flow search appears.
- ▶ Perform the core flow search and then press F1.
 - See also chapter Core flow search, Page 39.
 - \Rightarrow The measurement starts.
- ► Perform the measurement.
- ▶ Press F2, after you have performed the measurement.
 - \Rightarrow The menu assist appears.
 - ⇒ The measurement is collected in the measurement assistant.

| assist 🛛 🔋 📼 | | Core flow search | | | Program 1, Natural gas | , 🔊 📼 | | assist | , |
|------------------------|-----|------------------|---------|-----------|------------------------|--------------|----|------------------|--------------|
| T-boiler | | MAX °F | CURRENT | | 02 % | 20.8 | | T-boiler | |
| Annular-gap test 🖌 🖌 | | | 01 | | °F | 81.0 | | Annular-gap test | |
| Program 2 🖌 | | | | | T-air | Q1 () | | Program 2 | \checkmark |
| Program 1 | | | | | °F | 01.0 | | Program 1 | \checkmark |
| Program 3 | | | | | CO ppm | 0 | | Program 3 | |
| Program 4 | | | | | CO | 0 | | Program 4 | |
| Solid fuel measurement | | | | | mg/Nm³ref3%02 | U | | Solid fuel measu | rement |
| | | | | | Draft inchH2O -0 | .001 | | | |
| | 01/ | | | F1 | Pabs inchH20 408 | .044 | 50 | | |
| preview QR-4u Deletem. | UK | forward | | | stop collect | >clipboard | FZ | preview QR-4 | u Delete m. |

- ► Select Program 1.
- Press OK.
 - \Rightarrow If activated, the core flow search appears.
- ▶ Perform the core flow search and then press F1.
 - See also chapter Core flow search, Page 39.
- ▶ Press F2, after you have performed the measurement.
 - \Rightarrow The menu assist appears.
 - ⇒ The measurement is collected in the measurement assistant.

Reset collected measurements

You have the possibility to reset measurements already collected in the measurement assistant.



- Press the menu key.
 - \Rightarrow A selection list appears.
- Select Collect reset.
- Press OK.
 - ⇒ A message appears.
- Select YES.
- Press OK.
 - ⇒ The collected measurements are reset.

| | NOTE |
|---|--|
| | You can also reset the collected measurements directly via the function key bar. |
| i | T-boiler Annular-gap test Yrogram 2 Program 1 Yrogram 3 Program 4 Solid fuel measurement |
| | ▶ Press F3. ➡ A message appears. |

Print collected measurements

Before printing the collected measurements, you have the possibility to display a print preview.

| assist 🔋 📼 | | preview 🔋 🕞 | |
|-------------------------|-------|--------------------------|--|
| Theiler | | | |
| I-boller | | | |
| Annular-gap test 🖌 | | M R U GmbH | |
| Program 2 | | Fuchshalde 8+12 | |
| Program 1 🛛 🖌 | | 74172 Neckarsulm-Ob'heim | |
| Program 3 | | 07132/9962-0 Fax 9962-20 | |
| Program 4 | | www.mru.eu / info@mru.de | |
| Solid fuel measurement | | | |
| | | | |
| | | WED 03/09/2022 15:45:25 | |
| navious OD 4u Dolate m | F1 | • | |
| preview Qrc-40 Deletem. | · · · | | |

- ▶ Press F1.
 - \Rightarrow The menu preview appears.
- ► Press the Printer key.
 - \Rightarrow The printout is created.
 - See also chapter 7.11 Print measurement values, Page 62.

Individualise function key F2

Before you can export the collected measurements via QR code or Bluetooth or save them in the data memory, you must individualise the function key F2.

| assist 🔋 📖 | | assist 📕 | | Settingassist | , | | Setting assist | |
|------------------------|---|---------------------------------|-------|----------------|-----------|----------------|----------------|------------|
| T-boiler | | | | Use for F2 key | Bluetooth | | Use for F2 key | Data store |
| Annular-gap test 🖌 | 1 | preview (F1) | | | | | Bluetooth F2 | never |
| Program 2 🗸 | 1 | QR-40 (F2) Collectreset (F3) | | | | | | |
| Program 1 🛛 🖌 | | ORZIV | | | | | | |
| Program 3 | | Save last measurement | E | | | | | |
| Program 4 | 1 | Send Mail (QR) | | | | | | |
| Solid fuel measurement | 1 | Setting assist | | | | | | |
| | 1 | print-out (Pr) | | | | | | |
| | | Measurement menu (Esc) | | | | | | |
| | | | OK | | | | | 0 |
| preview QR-4u Deletem. | | preview QR-4u Deleter | n. UK | | | \blacksquare | | |

- ▶ Press the context menu.
 - \Rightarrow A selection list appears.
- ► Select Setting assist.
- ► Press OK.
 - \Rightarrow The menu Setting assist appears.
- ► Select the desired setting.

| Setting | Use | Representation in the display |
|-----------|---|---------------------------------|
| Bluetooth | Transferring measurement data to the MRU4u via Bluetooth | preview MRU4u Deletem. |
| QR-4u | Transferring meas- urement data via QR code to MRU4u | preview QR-4u Deletem. |
| QR-ZIV | Transmission of measurement data in ZIV format | preview QR ZIV Delete m. |
| store | Saving the measure- ment data in the data storage | preview store Deletem. |

| | | NOTE |
|--|-----------------------------|---|
| Setting assist Use for F2 key Bluetooth F2 | P P QR-4u If required | If you set Bluetooth to F2 "If re- quired", measurement data will al- ways be transmitted to MRU4u as soon as there is a connection be- tween the analyser and MRU4u. The display in the measurement as- sistant changes automatically as soon as a connection is established be- tween the analyser and MRU4u. |

Transmitting measurements to MRU4u

Before you can transmit measurements to MRU4u via Bluetooth, you must adjust the F2 function key accordingly.

- ► Open the menu Setting assist.
 - See also chapter Individualise function key F2, Page 48.
- ► Set Use for F2 key to Bluetooth.
- ► Exit the menu Setting assist.
- ► Connect the analyser to MRU4u.



▶ Press F2.

⇒ The measurements are transmitted to MRU4u.

Transmitting measurements to MRU4u via QR code

Before you can transmit measurements to MRU4u via Bluetooth, you must adjust the F2 function key accordingly.

▶ Open the menu Setting assist.

See also chapter Individualise function key F2, Page 48.

- ▶ Set Use for F2 key to QR-4u.
- Exit the menu Setting assist.

| Appular-gap test | | |
|------------------------|----|--|
| Program 2 | | |
| Program 1 🛛 🖌 | | |
| Program 3 | | |
| Program 4 | | |
| Solid fuel measurement | | |
| | | |
| | | |
| | БО | |

- ▶ Press F2.
 - \Rightarrow The QR-Code appears.
- ► Scan the QR-Code with MRU4u.

Setting assist

Transmitting measurements via QR code ZIV

Before you can transmit measurements to MRU4u via Bluetooth, you must adjust the F2 function key accordingly.

- ► Open the menu Setting assist.
 - See also chapter Individualise function key F2, Page 48.
- ► Set Use for F2 key to QR-ZIV.
- Exit the menu Setting assist.

| assist 🔋 💷 | | Type of QR Code |
|-------------------------|----|-----------------|
| T-boiler | | |
| Annular-gap test 🖌 | | |
| Program 2 | | |
| Program 1 🛛 🖌 | | |
| Program 3 | | |
| Program 4 | | |
| Solid fuel measurement | | |
| | | |
| | | |
| preview QR ZIV Deletem. | F2 | return |



- ▶ Press F2.
 - \Rightarrow The QR-Code appears.
- Scan the QR-Code with MRU4u.

Store measurements

Before you can transmit measurements to MRU4u via Bluetooth, you must adjust the F2 function key accordingly.

- ► Open the menu Setting assist.
 - See also chapter Individualise function key F2, Page 48.
- ► Set Use for F2 key to Data store.
- Exit the menu Setting assist.

| assist 🗾 🗖 | | Select a site |) | assist |
|-------------------------------------|----|--------------------------------------|----------|--------------------------------|
| T-boiler Annular-gap test | | Site #14# John Example | | T A The measured |
| Program 2 Program 1 Program 3 | | Examplestreet 47 0123 Exampletown | | P values have P been stored |
| Program 4 | | | | P |
| Solid fuel measurement | - | | | S |
| preview store Deletem. | F2 | new search | store F3 | preview store Deleterr |

- ▶ Press F2.
 - \Rightarrow The menu Select site appears.
- ► Select the desired site.
- Pres F3.
 - \Rightarrow The measured values have been stored.
 - See also chapter View measurements, Page 75.

| assist | |
|--------------------|---|
| T-boiler | |
| Annular-gap test | Image: A start of the start of |
| Program 2 | ✓ |
| Program 1 | \checkmark |
| Program 3 | |
| Program 4 | |
| Solid fuel measure | ment |
| | |
| preview store | Delete m. |

Send messages as E-Mail

You have the possibility to scan the measurements by OR code and send them as an e-mail. The email is sent from the smartphone using the MRU4u app.

| assist 🥫 💷 | | assist 📕 🗖 | D | assist 🔋 🗔 | | Type of QR Code |
|------------------------|-----|----------------------------|-----|------------------------|----|-----------------|
| T-boiler | | | | | | |
| Annular-gap test 🖌 | | preview (F1) | | Send email? | | |
| Program 2 🖌 | | Save last measurement (F2) | i i | (With smartphone | | |
| Program 1 🛛 🖌 | | Collectreset (F3) | | scan QR code) | | |
| Program 3 | | OR ZIV | 1 I | Yes | | Sector of the |
| Program 4 | | Send Mail (QR) | 1 1 | No | | |
| Solid fuel measurement | | Setting assist | í i | | | |
| | | print-out (Pr) | 1 | _ | | |
| | | Measurement menu (Esc) | | Measurement menu (Esc) | | |
| | 🖣 🕨 | | | | OK | |
| preview store Deletem. | | preview store Deletem | UN | preview store Deletem. | UK | return |

- ▶ Press the menu key.
 - \Rightarrow A selection list appears.
- ► Select Send Mail ...(QR).
- Press OK.
 - ⇒ A message appears.
- Press OK.
 - ⇒ The menu QR-Code appears.
- ► Scan the QR-Code with the app MRU4u.
 - ⇒ You can send the measurements as E-Mail.

7.3. Temporary buffer

The analyser offers you the possibility to store all momentary measured values in a temporary buffer while the measurement is running and to continue the measurement.

Later on, the values can be brought back from the temporary buffer to the measuring window in order to print them out or / and to save them.

Store values into temporary buffer

During a running measurement you can store the store the current values in the temporary memory.



- ► Start a Gas measurement.
 - See also chapter 7.1 Perform Gas measurement, Page 39.
- ▶ Press the menu key.
 - \Rightarrow A selection list appears.
- ► Select values to clipboard.
 - \Rightarrow The measured values are stored in the temporary buffer.

When the measurement is stopped, you can compare the currently displayed measured values with the measured values in the temporary buffer.

| Program 1, Natu | ral gas 🛛 🔋 📼 | | Program 1, Natu | ıral gas 🛛 👂 🗔 |
|-----------------------|-------------------|----|-----------------------|--------------------|
| T-gas °F | 72.5 | | T-gas °F | 72.5 |
| T-air °F | 73.0 | | T-air °F | 73.0 |
| CO2 % | 0.0 | | CO2 % | 0.1 |
| Dewpoint °F | 32.0 | | Dewpoint °F | 32.0 |
| 02 % | 20.9 | | 02 % | 20.9 |
| Draft inchH2O | 0.000 | | Draft inchH2O | 0.020 |
| CO ppm | 1 | 50 | CO ppm | 1 |
| start s | tore v./clipboard | гJ | start | store v./clipboard |

- Stop the Measurement.
 - \Rightarrow The measuring window is greyed out.
- ► Press F3.
 - ⇒ The measured values stored in the temporary memory are displayed.

If you have stopped a measurement without first storing the measured values in the temporary buffer, you can store the measured values directly in the temporary buffer from the function key bar.

| Program 1, Natu | ral gas 🛛 👂 🗔 | | Program 1, Na | atural gas 🛛 👂 🕞 |
|-----------------------|------------------|------------|-----------------------|--------------------|
| T-gas °F | 73.0 | | T-gas °F | 73.0 |
| T-air °F | 73.5 | | T-air °F | 73.5 |
| CO2 % | 0.1 | | CO2 % | 0.1 |
| Dewpoint °F | 32.0 | | Dewpoint °F | 32.0 |
| 02 % | 20.8 | | 02 % | 20.8 |
| Draft inchH20 | -0.001 | | Draft inchH2O | -0.001 |
| CO ppm | 1 | F 2 | CO ppm | 1 |
| start | store >clipboard | F3 | start | store v./clipboard |

- ► Stop the measurement.
 - \Rightarrow The measuring window is greyed out.
- ► Press F3.
 - \Rightarrow The measured values are stored in the temporary buffer.

Overwrite measured values in temporary buffer

You can overwrite the measured values stored in the temporary buffer with the currently displayed measured values

| Program 1, Natural g | jas 🔋 🕞 | Program 1 , Natural gas 🛛 🔋 🗀 | |
|----------------------|---------------|-------------------------------|----|
| T-gas °F | 72.5 | T-gas °F 73.0 | |
| T-air °F | 73.0 | CO-Limit | |
| C02 | 01 | stop (F1) | |
| % | U. I | Store measurement (F2) | |
| Dewpoint | 32.0 | overwrite clipboard (F3) | |
| ۳۲ | 52.0 | print-out (Pr) | |
| 02 % | 20.8 | Define measuring window | |
| Draft | 0 000 | Measurement menu (Esc) | |
| inchH2O | 0.000 | new draft zeroing | |
| CO | Ω | i | |
| ppm | U | ppm U | OK |
| stop stor | e 🔪 >clipbrd> | stop store >clipbrd> | UN |

- ▶ Press the menu key.
 - \Rightarrow A selection list appears.
- ► Select overwrite clipboard.
- ► Press OK.
 - ⇒ The temporary buffer is overwritten.
- You can overwrite the temporary buffer with current measured values at any time.

If necessary, you can process the currently displayed measured values further, e.g., print or store them

 See also chapter 7.10 Store measurement values, Page 60 and 7.11 Print measurement values, Page 62.

7.4. Perform Annular-gap test

The annular gap test checks whether the exhaust system is tight by measuring the O2 value of the combustion air.

| Measurement menu | | Selection meas.program | | Annular-gap test | Annular-gap test 🛛 📕 📼 | | Annular-gap test | I 📼 |
|--------------------------|---------|------------------------|----|---------------------------|------------------------|----|------------------|------------|
| Gas measurements | | Program 1 | | 7 | currently measured | | already measur | red |
| Particul. matter measur. | | Program 2 | | Hold probe in ambient air | ⁰² 20.97 | | ⁰² 20 |).90 |
| Determine Humidity | | Program 3 | | | co n | | со | 0 |
| Test 4-/8-Pa | | Program 4 | | Please wait | ppm U | | ppm | U |
| Pressure measurement | | Solid fuel measurement | | | | | | |
| Let by and tightness | | Annular-gap test | | | not measured vet | | currently measu | red |
| Gas flow measurement | | Test program | | | not mediated yet | | our entry medoe | a cu |
| AUX-Anemometer | | | | | Draft Pa | | Draft Pa | 49 |
| AUX-Humidity | | | | | Т-дар | | T-gap | λΛ |
| start storage ext | tras Of | | OK | | stop store draft/temp. | F3 | stop store | 02/C0 |

- Select Gas measurements.
- ► Press OK.
 - ⇒ The menu Selection meas. Program appears.
- ► Select Annular-gap test.
- ► Press OK.
 - ⇒ If necessary, an automatic zero-point measurement is is performed.
 - ⇒ The menu Annular-gap test appears.
- ► Press F3.
 - ⇒ The currently measured values for Draft and T-gap are displayed.

The MRU annular gap multi-hole probe No. 56352 is suitable for annular gap measurement. The silicone hose is attached to the condensate separator of the analyser.

Optionally, the annular gap multi-hole probe can be attached to the measuring probe of the analyser with the probe coupling MRU No. 11652.

7.5. Perform Test program

The test program is used by test facilities to check the analyser by means of test gas in the measuring program.

No calculations are performed during the test program.

| Measurement menu 🛛 🖉 📼 | | Selection meas.program | , | | Test program | |
|-------------------------|-----|------------------------|---|----|--------------------|----------------------|
| Gas moasuromonts | | Program 1 | | | 02 % | 21.0 |
| Brossure measurement | | Program ? | | | CO | -0 |
| Pressure measurement | | Program 2 | | | ppm | -0 |
| Diff. temp. measurement | | Program 3 | | | NO | 0 |
| Last measured values | | Program 4 | | | T-nas | 77.0 |
| 400DH (ext. Sonde) | | Test program | | | °F | //.0 |
| Zeroing | | | | | T-air °F | 77.5 |
| | | | | | Draft inchH2O | -0.002 |
| | 01/ | | | | | |
| start storage extras | UK | | | OK | stop (| CO off 🔪 > clipboard |

- ► Select Gas Measurements.
- ► Press OK.
 - ⇒ The menu Selection meas. program appears.
- ► Select Test program.
- ► Press OK.
 - \Rightarrow The Test program is started.

7.6. CO/H2 and CO high (optional)

If that exceeds CO the CO threshold, then to CO high, the measured value is red indicated - also the calculated values - is switched.

The CO value exceeds 10.000 ppm to % is in such a way switched (example 1.00%).

If the CO value sinks below the CO threshold, then the red CO value becomes again black

Starting from this moment the purge pump can be switched off over the menu key again.

7.7. Non-continuous draft measurement

The analyser provides for a non-continuous draft measurement. The draft measurement is disabled when a maximum time after zeroing has elapsed or a significant change in temperature has been detected by the instrument. The maximum time is configured to 10 minutes. If the draft measurement is disabled it is displayed with "--.-". The draft measurement can be enabled again by zeroing the draft: F3 key "zero draft".

To indicate that the draft measurement is not continuously available it is displayed in colour red.

The user can freeze the draft data by means of the F3 key "hold draft". The frozen data is displayed in green.

The unfreeze the measurement one has to exit the menu and enter again

All other measurements are processed continuously independent of the draft measurement status.

7.8. Perform pressure measurement

Pressure (4 values) is measured and saved to the selected measurement name. The actual measured value is displayed in the middle of the dis-play. The 4 measurement names can be changed as desired.

The hose on the draft + connector must be connected for draft measurements.

The second hose on the Delta P- connector must be connected for differential measurement.

| Measurement menu 🛛 🕫 🕞 | | Pressure measurement | |
|-------------------------|----|----------------------|-------|
| Gas measurements | | | hPa |
| Pressure measurement | | Differ.pressure | 0.00 |
| Diff. temp. measurement | | Gas flow press. | 0.00 |
| Last measured values | | Pressure 3 | 0.00 |
| 400DH (ext. Sonde) | | Pressure 4 | 0.00 |
| Zeroing | | pressure peak | 0.00 |
| | | | hPa |
| | | 0. | 36 |
| start storage extras | OK | accept zeroing | store |

- ► Go to the measurement menu.
- ► Select Pressure measurement.
- ► Press OK.

| | Pressure measurement |
|---|------------------------|
| | |
| | Reset values |
| | Modify name |
| | Parameter |
| | print-out (Pr) |
| | accept (F1) |
| | zeroing (F2) |
| | Store measurement (F3) |
| | graphical (») |
| | Measurement menu (Esc) |
| 1 | |
| | accept zeroing store |

- Press the menu key.
 - \Rightarrow A selection list appears.
- Select the desired item from the selection list. For example, select the Parameter to set the unit as well as the damping (T90/s).

7.9. Perform Differential temperature measurement

In the differential temperature measurement menu two temperatures can be measured simultaneously by using the T1 and T2 connectors. Both measured temperatures and the difference between the temperatures will be displayed.

- ▶ Plug a temperature sensor into the T1 connection.
- ▶ Plug a temperature sensor into the T2 connection.



NOTE



The accuracy of the difference temperature measurement is guaranteed only on use of the MRU temperature sensors.

| Measurement menu 🛛 📭 📼 | | Diff. temp. measurement | | | Diff. temp. measuremen | |
|-------------------------|----|-------------------------|----------|-----|------------------------|-----|
| Gas measurements | | 182 | 187 | | (T2) Feed line | ۴F |
| Pressure measurement | | 120 | 199 | | | |
| Diff. temp. measurement | | 130- | 135 | | Č Č | 1.U |
| Last measured values | | 78 | 78 | | (T1) Return line | ۴F |
| 400DH (ext. Sonde) | | | | | | |
| Zeroing | | (T2) Feed line °F | 113.5 | | · 84 | t.J |
| | | (T1) Return line °F | 86.5 | | Difference | ۰E |
| | | Difference °F | | | birreichee | |
| | | 27 | 7 0 | | | 1.5 |
| | OK | Z | .0 | ◀ ► | | |
| start storage extras | UN | align | Re-start | ▼ | | |

- ► Go to the Measurement menu.
- Select Diff. Temp. measurement.
- ► Press OK.
 - ⇒ The menu Diff. temp. measurement appears.
 - \Rightarrow The temperatures T1, T2 and the difference appears.

- ▶ Press the menu key.
 - \Rightarrow A selection list appears.
- Select the desired item from the selection list. For example, select the print-out (Pr) item to print the measurement.

7.10. Store measurement values

If "store" is displayed in the function key bar, you can save measurement results to the data memory using the related function key F2 or F3.

The function of the data storage is displayed in chapter 8 Data storage, Page 67.

| Program 1 , Natural gas 🛛 🔋 🗖 |) | Program 1, Natural gas | | | | Select a site | | Program 1 , Natural gas 🛛 🛛 🖉 📼 |
|--|------------|------------------------|------------|----|---|------------------|----|---------------------------------|
| CO mg/m ³ 0.0 |) | CO mg/m³ | 0.0 | | | Site #14# | | C D |
| °° 23.4 | ŀ | T-air ℃ | 23.4 | | | John Example | | T: °(The measured |
| % 0.0 |) | CO2 % | 0.0 | | | | - | c values have |
| T-gas 00 / | | T-gas | | | | Examplestreet 47 | - | been stored |
| °C 23.4 | ŀ | °C | 23.3 | | | 0123 Exampletown | | i D |
| ⁰² 21.0 | | 02 % | 21.0 | | | | - | ° (|
| Draft hPa -0.05 | • | Draft hPa | 0.05 | | | | | Di hPa |
| Air ratio | Property 1 | Air ratio | [| | | | | Air ratio |
| stop store >clipboard | | start store | >clipboard | F2 | • | new store | F3 | • start store >clipboard |

- Press F1.
 - \Rightarrow The measurement is stopped.
 - \Rightarrow The measurement window is greyed out.
- ▶ Press F2.
 - \Rightarrow The menu Select a site appears.
- Select the desired site.
- ► If necessary, press F1 to select a new site.
 - See also chapter Create new site, Page 68.
- ▶ Press F3.
 - \Rightarrow The measured values have been stored.
 - See also chapter View measurements, Page 75.

Enter T-boiler, Soot and Derivative

The analyser does not have a soot measurement.

However, you can enter determined soot data to save or print them together with the measurement data.

| NOTE |
|---|
| Before you can enter the soot data, you have to acti- |
| vate the setting "Add soot & T-boiler" in the menu |
| Measurement settings. |
| See also chapter 5.4 Set measurement, Page 26. |



 After a successful measurement, you can enter the externally determined measured values.

| _ | _ |
|---|---|
| | |
| | |
| | |
| | |

NOTE The input of soot numbers and derivative is only possible for fuel oil / diesel.

| Program 2, Oil heavy | P 💼 | Enter | . | Enter | , |
|----------------------|------------|-------------|-------------|------------------|----------|
| CO | Ω | | | | |
| ppm/ref0%02 | 0 | T-boiler | ? | T-boiler | 75 |
| CO ppm | 0 | Soot no. 1 | ? | Soot no. 1 | 1 |
| со | 0.0 | Soot no. 2 | ? | Soot no. 2 | 0 |
| mg/kWh | 0.0 | Soot no. 3 | ? | Soot no. 3 | 0 |
| Pabs 100 | 7.03 | Derivative | no | Derivative | no |
| 02 | 210 | | | | |
| Dewpoint | 0.0 | | | | |
| Draft | 0.00 | | | | |
| hPa - | 0.08 | F2 | | | |
| start store | >clipboard | print-out Q | RMIRU store | print-out QR MRU | store |

▶ Press F2.

 \Rightarrow The menu Enter appears.

- Enter the determined value for the T-boiler and, if available, the determined values for soot number 1, soot number 2, soot number 3 and derivative.
- ▶ Press F1 to create a printout.
- ▶ Press F2 to display an OR code of the measurement.
- ▶ Press F3 to store the measurement.

7.11. Print measurement values

You have the possibility to print measurement results via the following optionally available printers.

- Speed printer (IR desktop printer)
- HSP 580 (Highspeed-Bluetooth-Thermoprinter)



Open menu print-out

| Settings | | | print-out | |
|---------------------|----------|----|------------------|---------------|
| LCD brightness (%) | 50 | | Printer type | Speed-Printer |
| Country USA | /intern. | | Print site lines | : 1 |
| Language | English | | Print analyzer | info OFF |
| LED condensate trap | OFF | | | |
| Helpful hints | ON | | | |
| Font S | tandard | | | |
| Cursor colour S | tandard | | | |
| Power-ON protection | OFF | | | |
| Keyboard beep | OFF | | | |
| print-out ea | surement | F1 | te | est |

- ► Open the menu Settings.
 - See also chapter 5.2 Customize settings, Page 23.
- ▶ Press F1.
 - \Rightarrow The menu print-out appears.
- ► Set the desired settings.

| Setting | Description |
|---------------------|--|
| Printer type | Selection of the printer type |
| Print site lines | Line 1 (plant number) is required. The other lines (free text lines) can be printed if required. |
| Print analyser info | Measurement printouts can be made shorter by omitting the analyser. However, in some printouts (calibra- tion, service, etc.) the info is still printed. |

Print measurement results with Speedprinter

| print-out | , | | print-out | 9 📼 |
|---------------------|----------|----------------|-----------------|---------------|
| Printer type Blueto | ooth-HSP | | Printer type | Speed-Printer |
| BT address | | | Print site line | es 1 |
| Firmware version | 1.3.1.0 | | Print analyze | rinfo OFF |
| Print site lines | 1 | | | |
| Print analyzer info | OFF | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| test | | \blacksquare | | test |

- ► Go to the menu print-out.
 - See also chapter Open menu print-out, Page 62.
- ► Select Speed-Printer as Printer type.
- ► Align the printer as follows:



- Press the printer key. Optionally, press the context menu key and select Printout (Pr.)
 - \Rightarrow A print-out is created.

Further technical specifications as well as battery and paper rolls changes please see separate printer manual.

Print measurement results with Highspeed-Bluetooth-Thermoprinter

- ► Go to the menu print-out.
 - See also chapter Open menu print-out, Page 62.

| print-out | print-out | | print-out | print-out | â 8 🗊 💷) | |
|----------------------------|----------------------------|----|----------------------------|---------------------|----------|------------|
| Printer type Speed-Printer | Printer type Bluetooth-HSP | | Printer type Bluetooth-HSP | Printer type Bluet | ooth-HSP | |
| Print site lines 1 | BT address | | BT address | BT address 6612E | B15043F | |
| Print analyzer info OFF | Firmware version 1.3.1.0 | | Firmware version 1.3.1.0 | Firmware version | 1.3.1.0 | |
| | Print site lines 1 | | Print site lines 1 | Print site lines | 1 | |
| | Print analyzer info OFF | | Print Make connection OFF | Print analyzer info | OFF | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | E2 | | | | E 2 |
| test | test | FZ | test | test | disc. | гэ |

- ► Select Bluetooth-HSP as Printer type.
- ► Press F2.
 - ⇒ The connection between analyser and the printer is established.
 - After the connection between the analyser and the printer has been established, the Bluetooth address (BT address) appears in the display.

An existing connection to a printer is indicated by a printer icon and a Bluetooth icon.



Press F3 to disconnect the analyser from the printer.

You can also disconnect an existing connection between Bluetooth and printer in the Measurement menu:



- ► Go to the Measurement menu.
- Press the Press the menu key.
 - \Rightarrow A selection list appears.
- ► Select Disconnect printer.
- Press OK
 - \Rightarrow The printer is disconnected.

7.12.Stop measurement

A running measurement can be stopped at any time by pressing the F1 key. The window changes colour and the measured values are frozen. All measured values available at the time of stopping are available in the analyser and can still be displayed. By pressing the ESC key, the analyser returns to Measurement menu.

7.13. Last measured values

The analyser offers the possibility to continue working with the last measured values after the end of a measurement.

| Measurement menu | | Program 1 , Natural gas 🛛 🔋 🗔 | | Program 1, Natural gas | |
|-------------------------|----|-------------------------------|-----------|------------------------|------------|
| Gas measurements | | ^{T-gas} 79.0 | | T-gas °F | 79.5 |
| Pressure measurement | | T-air 79.5 | | T-air °⊏ | 80.0 |
| Diff. temp. measurement | | C02 00 | | C02 | 0.0 |
| Last measured values | | % U.U | | % | 0.0 |
| 400DH (ext. Sonde) | | ^{Dewpoint} 32.0 | | Dewpoint °F | 32.0 |
| Zeroing | | ⁰² 21.0 | | 02 % | 21.0 |
| | | Draft -0.000 | | Draft inchH2O |).000 |
| | OK | ppm 0 | E1 | CO ppm | 0 |
| start storage extras | UN | start store QR Code | L L L | stop store | >clipboard |

- ► Go to the Measurement menu.
- Select Last measured values
 - \Rightarrow The measuring window with the last measured values appears.
- ► Press F1.
 - \Rightarrow The measurement is continued.

8 Data storage

8.1. Organize data storage

The basis for the data storage of the analyser is saved sets of sites inside the analyser. Each site has a distinct site number as well as 8 additional free text lines for names and address.

The analyser can store up to 32,000 different sites.

Sites can be newly created and changed in the analyser, or are transferred e.g., via a PC - program by means of ZIV - module.



NOTE

New sites created in the analyser will NOT be transferred back to the computer program. When transferring data from the analyser to the computer only measurement data will be transferred, identified by the site number that has been assigned to the measurement, when the measurement was saved.

Measurements are stored by assigning them to a site. Measurements can be gas measurements or other measuring programs available in the analyser.

8.2. Call up information about Memory info

In the menu item "storage" you select "memory info" to get information about the actual memory volume. The part of free memory, the total number of the stored sites and the number of the measurements stored all together, split in the kind of the measurement is listed.

| Measurement menu 🛛 🔋 💷 | | Storage menu | , | Memory info | |
|-------------------------|----|-------------------------|--------|---------------------|---------|
| Gas measurements | | Sites administration | | Available memory | 100.0 % |
| Pressure measurement | | Delete all sites | | Sites | 3 |
| Diff. temp. measurement | | Sites from SD card | | Program 1 | 1 |
| Last measured values | | Sites onto SD card | | Program 2 | 0 |
| 400DH (ext. Sonde) | | View measurements | | Program 3 | 0 |
| Zeroing | | Delete measurements | | Program 4 | 0 |
| | | Measurements to SD care | d | Annular gap meas. | 0 |
| | | Memory info | | Pressure measuremen | nt O |
| | | | | _ | |
| start storage extras | F2 | measure sites ext | ras OK | | |

- ► Go to the Measurement menu.
- ▶ Press F2.
 - \Rightarrow The Storage menu appears.
- ► Select Memory info.
- ► Press OK.

- ⇒ Das Menü Speicher Info erscheint.
- \Rightarrow The menu Memory info appears.
- ⇒ Information about the data storage is listed.

8.3. Sites administration

In the sub menu Sites administration, you can: Im Menüpunkt Anlagenstamm können Sie

- View all data of the stored sites
- Create new sites
- Change data on existing sites
- Delete sites



NOTE New sites created in the analyser will NOT be transferred to a PC program

Create new site

| Storage menu | Sites administration | | Modify site | | Modify site | | Modify site | |
|-------------------------|----------------------|---|--------------------------|-----------|--------------------------|----|-------------------------|---|
| Sites administration | | | Site no. (required) | | Site #1# | | Site #1# | |
| Delete all sites | No stored sites | | Free text (e.g. name) | | Free text (e.g. name) | | John Example | |
| Sites from SD card | | | Free text (name suppl.) | | Free text (name suppl.) | | Free text (name suppl.) | |
| Sites onto SD card | | | Free text (street & no.) | | Free text (street & no.) | | Example Street 47 | |
| View measurements | | | Free text (ZIP & town) | | Free text (ZIP & town) | | 1234 Exampletown | |
| Delete measurements | | | Free text | | Free text | | Free text | |
| Measurements to SD card | | | Free text | | Free text | 1 | Free text | |
| Memory info | | | Free text | E1 | Free text | | Free text | |
| | | | Free text | | Free text | | Free text | |
| measure sites extras | 2 new | F | 1 modify auto no. | F2 | modify store | F1 | modify store | e |

- ► Go to the Storage menu.
- Press F2
 - ⇒ The menu Sites administration appears.
- Press F1.
 - \Rightarrow The menu Modify site appears.
- Press F1 to assign manually a site number to the site.
- Press F2 to assign automatically a site number to the site.
 - \Rightarrow The site is assigned a site number.
- Select the free text lines that you want to edit.
- Press F1.
 - \Rightarrow A window appears.
- Enter the desired content.
- ▶ If necessary, select free text lines and fill them with content.
- Press F3.
 - \Rightarrow The site is stored.

| Storage menu 👂 🕞 | | Sites administration | • | | | Sites administration |
|-------------------------|----|----------------------|---|---|---|----------------------|
| Sites administration | | Site #1# | | | | Site #2# |
| Delete all sites | | John Example | | | | James Smoke |
| Sites from SD card | | | | | | |
| Sites onto SD card | | Example Street 47 | | | | Examplestreet 34 |
| View measurements | | 1234 Exampletown | 1 | | | 1234 Examplestreet |
| Delete measurements | | | 1 | | | |
| Measurements to SD card | | | 1 | | | |
| Memory info | | | | | 1 | |
| | | | | | | |
| measure sites extras | OK | new modify delete | | ▼ | | new modify delete |

- ► Go to the Storage menu.
- ► Select Sites administration.
 - ⇒ The menu Sites administration appears.
 - ⇒ Each stored site is displayed on a page with the colored site number and eight additional free text lines.
- If necessary, scroll through the sites until you have found the desired site.

Change sites

| Storage menu 🖉 📖 | | Sites administration | , | | Sites administration | | Modify site | - | Modify site | |
|-------------------------|----|----------------------|--------|----------------------------------|----------------------|---------------------------------------|-------------------------|--|---------------------|-------|
| Sites administration | | Site #1# | | | Site #2# | | Site #2# | | Site #2# | |
| Delete all sites | | John Example | | | James Smoke | | James Smoke | | James Wood | |
| Sites from SD card | | | | | | | Free text (name suppl.) | | Free text (name sup | opl.) |
| Sites onto SD card | | Example Street 47 | | | Examplestreet 34 | | Examplestreet 34 | | Examplestreet 34 | |
| View measurements | | 1234 Exampletown | | | 1234 Examplestreet | 1234 Examplestreet 1234 Examplestreet | | | 1234 Examplestree | t |
| Delete measurements | | | | | | | Free text | | Free text | |
| Measurements to SD card | | | | | | | Free text | | Free text | |
| Memory info | | | | | | | Free text | | Free text | |
| | | | 1 | | | | Free text | | Free text | |
| measure sites extras | OK | new modify | delete | ▲ ▶ | new modify | _{delete} F2 | modify store | Angeneral Angeneral Mittalens Systel | modify | store |

- ► Go to the Storage menu.
- ► Select Site administration.
- Press OK.
 - \Rightarrow The menu Sites administration appears.
- Select the site that you want to change.
- Press F2.
 - ⇒ The menu Modify site appears.
- ► Select the free text line that you want to change.
- Press F1.
 - \Rightarrow A window appears.
- Enter the desired changes.
- If necessary, select further free text lines and change the corresponding free text lines.
- Press F3.
 - \Rightarrow The changes are stored.

Delete sites

You can delete sites individually or delete all sites simultaneously

Delete sites individually

| Storage menu 🔋 📼 | Sit | tes administration | | | Sites administration | | Sites administration | P 📼 |
|-------------------------|-----|--------------------|--------|----------|----------------------|----------------------|----------------------|------------|
| Sites administration | Si | ite #1# | | | Site #2# | | ATTENTION ! | |
| Delete all sites | Jo | ohn Example | | | James Smoke | | Delete the selecter | - Î |
| Sites from SD card | | | | | | | site and all assigne | d |
| Sites onto SD card | Ð | kample Street 47 | | | Examplestreet 34 | | measurements ? | |
| View measurements | 12 | 234 Exampletown | | | 1234 Examplestreet | | | |
| Delete measurements | | | | | | | continue | |
| Measurements to SD card | | | | | | | abort | |
| Memory info | | | | | | | | |
| | | | | | 1 | | | |
| measure sites extras | ОК | new modify | delete | V | new modify | _{delete} F3 | new modify d | lelete |

- ► Go to the Storage menu.
- ► Select Sites administration.
- ▶ Press OK.
 - ⇒ The menu Sites administration appears.
- ► Select the site you want to delete.
- ► Press F3.
 - \Rightarrow A message appears.
- ► Select continue to delete the site.
- ► Select abort to retain the site.
- ▶ Press OK.
 - \Rightarrow Depending on the selection, the site is deleted or retained.

Delete all sites

| Storage menu | | Storage menu 🔋 🗔 | |
|-------------------------|----|----------------------|----|
| Sites administration | | ATTENTION ! | |
| Delete all sites | | A∥ stored sites and | |
| Sites from SD card | | all measurements | |
| Sites onto SD card | | will be deleted ! | |
| View measurements | | | |
| Delete measurements | | continue | |
| Measurements to SD card | | abort | |
| Memory info | | | |
| | | | |
| | F3 | | 0K |
| measure sites extras | | measure sites extras | UN |

- ► Go to the Storage menu.
- ► Select Delete all sites.
- ▶ Press OK.
 - ⇒ A message appears.
- ► Select continue to delete all sites.
- ► Select abort to retain all sites.
- ► Press OK.
 - \Rightarrow Depending on the selection, the sites are deleted or retained.

8.4. Transfer data via using SD card

The data exchange format is CSV. A character-separated values (CSV) file is a simple text format for a database table. Each record in the table is one line of the text file. Each field value of a record is separated from the next by a character. The analyser uses a semi-colon ';' as value separator (other implementations use sometimes a comma). Implementations of CSV can often handle field values with embedded line breaks or separator characters by using quotation marks or escape sequences. CSV is a simple file format that is widely supported, so it is often used to move tabular data between different computer programs, for example Microsoft Excel[™] or Access[™], that support the format. Also, other computer programs offer this type of interface because it is widely spread and easy to use.

The following functions are available:

- Import sites
- Export sites
- Export measurements

Import sites

With this function you can import Sites which have been created on a computer or another Analyser.

The File name must have the name "anlagen.csv" (anlagen = German for sites). The file has no column heading that means that the first line al-ready has user data. Each line has a minimum of 9 columns (with 8 semi-colons) and the first field in the line will be the site number. All data will be imported as long a site number is available. Per field a maximum of 24 characters will be imported, too long words will be cut off.

NOTE

Before you can import sites via a CSV file, you have to rename the desired CSV file to anlagen.csv. Save the renamed CSV file in the root directory of the SD card.

NOTE



While importing data from the SD Card to the analyser there is no check for double site numbers (Line 1), neither inside of the file that is imported nor between the file and the sites already inside the analyser. The analyser can easily handle double site numbers but you could face problems with double site numbers when exporting them again to a computer program

| Storage menu | • | Sites from SD card | | | Sites from SD card | |
|-------------------------|----|----------------------|-------|-----|--------------------|-------|
| Sites administration | | Sites from SD card | | | Sites from SD card | |
| Delete all sites | | | | | | |
| Sites from SD card | | CSV sites file found | | | Import finished | |
| Sites onto SD card | | | | | | |
| View measurements | | Found sites CSV | 5 | | Found sites CSV | 5 |
| Delete measurements | | | | | | |
| Measurements to SD card | | Imported sites | 0 | | Imported sites | 5 |
| Memory info | | Max. importable | 32000 | | Max. importable | 31995 |
| | | | | | | |
| | OK | | | F2 | | |
| measure sites extras | JI | import CSV | | . 2 | | |

- ► Go to the Storage menu.
- Select Sites from SD card.
 - ⇒ The menu Sites from SD card appears.
- ▶ Press F2.
 - \Rightarrow The sites are imported.
Export sites

This function can be used for an analyser back up or if you wish to sup-ply the analyser information to a computer program or another ana-lyser. This is very handy if you have made some modifications inside the analyser (site) for example if you have modified the phone number of a customer and this modification needs to be updated in the computer software, or if a second analyser needs to have the same site information. The File format it's the same as described above "Import sites".

Only the file name is different, the file name will be ,ANLxxxxx.csv', in which the xxxxx are continuing 5-digit numbers with leading zeros.

| Storage menu 🔋 📼 | | Sites onto SD card | | | Sites onto SD card | |
|-------------------------|----|--------------------|---|----|--------------------|---|
| | | | | | | |
| Sites administration | | | | | | |
| Delete all sites | | Sites onto SD card | | | Sites onto SD care | d |
| Sites from SD card | | | | | | |
| Sites onto SD card | | Sites | 5 | | Sites | 5 |
| View measurements | | exported | 0 | | exported | 5 |
| Delete measurements | | | | | | |
| Measurements to SD card | | | | | | |
| Memory info | | | | | | |
| | | | | | | |
| | 0K | | | F2 | | |
| measure sites extras | | export CSV | | 12 | | |

- ► Go to the Storage menu.
- ► Select Sites onto SD card.
- ► Press OK.
 - \Rightarrow The menu Sites onto SD card appears.
- Drücken Sie F2.
- ► Press F2.
 - \Rightarrow The sites are exported onto SD card.

If the file must be imported into another analyser, the file must first be renamed into "anlagen.csv".

Export measurements

With this function, the analyser can make its stored measurements available to a PC.

Attention, this function is not suitable as a backup or for transferring the measurements to other measuring devices, as the measurements cannot be imported again.

| Storage menu 🛛 🔋 📟 | | Measurements to SD card | P 💼 | |
|-------------------------|----|-------------------------|------------|---|
| Sites administration | | Measurements to SD c | ard | |
| Delete all sites | | | | |
| Sites from SD card | | | | |
| Sites onto SD card | | Gas measurements | 4 | |
| View measurements | | Pressure measurem. | 2 | |
| Delete measurements | | | | |
| Measurements to SD card | | | | |
| Memory info | | | | |
| | | | | |
| | 0K | aumant 0014 | | F |
| measure sites extras | | exportCSV | | |

- ► Go to the Storage menu.
- ► Select Measurements to SD card.
- Press OK.
 - ⇒ The menu Measurements to Sd card appears.
- Select the measurement type you want to export. In this example, gas measurements are exported.
- Press F2.
 - \Rightarrow The measurements are exported.

8.5. Measurements in Data storage

View measurements

| Storage menu 🔋 📼 | | View measurements | , 🛛 📼 | | Gas measurements 🛛 🛛 🔎 📼 | | Program 1 , Natural gas 🛛 📕 📟 | | QR Code |
|-------------------------|----|--------------------|-------|----|-----------------------------|----|-------------------------------|----|-------------------|
| Sites administration | | View measurements | | | SAT 10/23/2021 16:59:16 | | ^{T-gas} 78.5 | | |
| Delete all sites | | | | | Site #1# | | T-air 78.5 | | |
| Sites from SD card | | Gas measurements | 4 | | Program 2 | | C02 | | |
| Sites onto SD card | | Pressure measurem. | 2 | | Natural gas | | % U.U | | |
| View measurements | | | | | | | Dewpoint 32.0 | | |
| Delete measurements | | | | | | | 02 01 0 | | |
| Measurements to SD card | | | | | | | % ZI.U | | ■12°24,778,228,42 |
| Memory info | | | | | | | Draft -0.016 | | |
| | | | | | 1 | | co n | | |
| measure sites extras | OK | view | | F2 | this site meas. val. delete | F2 | ppm V overview QR Code | F3 | return |

- ► Go to the Storage menu.
- Select View measurements.
 - ⇒ The menu View measurements appears.
 - An overview of the number of stored measurements depending on the measurement type appears.
- Select the desired measurement type.
 In this example, gas measurements are selected.
- Press F2.
 - ⇒ Then you first get a page with context information about the saved measurements
- ► Select the desired measurement.

NOTE



You have the possibility to select only the measurements that are stored for a site by selecting F1 = "this site" while a measurement of the desired site is displayed. With F1 = "all sites" you cancel this filter again.

- Press F2.
 - ⇒ The measured values of the stored measurements are displayed in detail.
- ▶ Press F3 to display gas measurements as an OR Code

Delete measurements

You can

- Delete single measurements
- Delete all measurements or delete all measurements of a measurement type

Delete single measurements

| Storage menu 🛛 🖉 📼 | | View measurements |] 📼 | | Gas measurements | | Gas measurements | |
|-------------------------|----|--------------------|-----|----|-----------------------------|----|-------------------------|-------|
| Sites administration | | View measurements | | | SAT 10/23/2021 16:59:16 | | ATTENTION ! | |
| Delete all sites | | | | | Site #1# | | The poloeted | |
| Sites from SD card | | Gas measurements | 8 | | Program 2 | | measurement | |
| Sites onto SD card | | Pressure measurem. | 2 | | Natural gas | | will be deleted ! | |
| View measurements | | | | | | | | |
| Delete measurements | | | | | | | continue | |
| Measurements to SD card | | | | | | | abort | |
| Memory info | | | | | | | | |
| | | | | | | | | |
| measure sites extras | OK | view | | F2 | all sites meas. val. delete | F3 | all sites meas. val. de | elete |

- ► Go to the Storage menu.
- Select View measurements.
- Drücken Sie OK.
- ▶ Press OK.
 - ⇒ The menu View measurements appears.
 - An overview of the number of stored measurements depending on the measurement type appears.
- ► Select the desired measurement type.
- ► Press F2.
 - \Rightarrow The stored measurements are displayed.
- ► Select the measurement you want to delete.
- ► Press F3.
 - \Rightarrow A message appears.
- Select continue to delete all sites.
- ► Select abort to retain all sites.
- Press OK.
 - ⇒ Depending on the selection, the measurements are deleted or retained.

Delete all measurements

| Storage menu 🛛 🖉 📼 | | Delete measurements | | | Delete measurements | P 💼 |
|-------------------------|----|-----------------------|----|----|---------------------|------------|
| Sites administration | | Delete measurements | | | ATTENTION ! | |
| Delete all sites | | | | | All polootod | |
| Sites from SD card | | All measurement types | 10 | | measurements |) |
| Sites onto SD card | | Gas measurements | 8 | | will be deleted ! | 1 |
| View measurements | | Pressure measurem. | 2 | | | |
| Delete measurements | | | | | continue | |
| Measurements to SD card | | | | | abort | |
| Memory info | | | | | | |
| | | | | | | |
| | F3 | | | F2 | | |
| measure sites extras | | delete | | | delete | |

- ► Go to the Storage menu.
- ► Select Delete measurements.
- ► Press OK.
 - ⇒ The menu Delete measurements appears.
- ► Select which measurement type you want to delete.
- ▶ Press F2.
 - \Rightarrow A message appears.
- Select continue to delete all sites.
- ► Select abort to retain all sites.
- ► Press OK.
 - ⇒ Depending on the selection, the measurements are deleted or retained.

9 Extras / Adjustment

The analyser is delivered with a standard preset software, which should cover your needs in most cases. However, the settings are highly flexible and customizable.

If you want to change various settings, we recommend that you do so with a little thought. The better you plan the settings, the less often you will have to correct them and the more comfortable you will be working with the analyser.

Use the possibilities of the individually configurable measuring methods, measuring displays, pressure outputs and self-selecting fuels in such a way that all your practical requirements are met as far as possible. Then you will rarely have to make changes to the settings again. After making changes to the settings, you should switch off the analyser once briefly so that the changes are permanently saved and take effect when you restart the analyser.

9.1. Service menu

The Service menu is protected by a PIN code against unauthorized access.

For the PIN code, contact an MRU service center (<u>www.mru.eu</u>). If you have started the PIN code query by mistake, press the ESC key. You will return to the Extras menu.

| Extras menu | - | Extras menu 🔋 📼 |
|--------------------------|----|--------------------------|
| Settings | | Settings |
| Date & time | | Data & time |
| Service menu | | |
| Default settings | | Service |
| Service values | | Enter PIN-code |
| Leak proof test | | |
| Contents SD card | | * * * * * * * |
| Device info | | Devicenno |
| | | |
| measure storage settings | OK | measure storage settings |

- ► Go to the Extras menu.
- Select Service menu.
- Press OK.
 - \Rightarrow A window for entering the PIN-code appears.
- ► Enter the PIN-Code.
 - ⇒ If you enter the PIN-code correctly, you will have access to the service menu.
 - ⇒ If the PIN-code is entered incorrectly, you will be returned to the Extras menu.

9.2. Default settings

The analyser is reset to the default settings.



| Settings Date & time Service menu Default settings | | ATTENTION ! Reset to factory default causes the loss of all individual settings! | |
|---|----|---|----|
| Service values | | Reset now? | |
| Leak proof test | | No | |
| Contents SD card | | Yes | |
| Device info | | | |
| measure storage settings | OK | measure storage settings | 0K |

- ► Go to the Extras menu.
- ► Select Default settings.
- ► Press OK.

 \Rightarrow A window appears.

- ► Select "No" to not reset the default settings.
- ► Select "Yes" to reset the analyser to default settings.
- ► Press OK.
 - ⇒ Depending on the selection, the analyser is reset to the default settings or not.

9.3. Service values

Should your analyser display an error message after zeroing (for exam-ple: "O2-Sensor not OK"), then you can use the Service value menu to get detailed information about possible defects. In this menu you will see all service values of the sensors and also other parameters.

In case of a defect contact the MRU service department. The MRU service technician will ask you about these values or he will ask you to send them by fax or email.

| Extras menu 🔋 📼 | | Service values (raw) | | |
|--------------------------|----|----------------------|----------|----|
| Settings | | 02 [mV] | 10.795 | |
| Date & time | | CO [mV] | 0.002 | |
| Service menu | | H2 [mV] | 0.001 | |
| Default settings | | NO [mV] | 0.007 | |
| Service values | | TC-Gas | -0.006 | |
| Leak proof test | | TC-Air | -0.007 | |
| Contents SD card | | TC-Lemo | 492.911 | |
| Device info | | PT-ref | 1.092 | |
| | | PT-ref-L | 1917.001 | |
| | OK | - | | F1 |
| measure storage settings | | Gas pump Purge pun | qu | |

- ► Go to the Extras menu.
- Select Service values.
- Press OK.
 - ⇒ The Menu Service values appears.
- ► If necessary, press F1 to switch on the function test of the Gas pump
- If necessary, press F2 to switch on the function test of the Purge pump.
- ► Press OK.
 - \Rightarrow A window for entering the Pin-Code appears.



NOTE

For the PIN code, contact an MRU service center (www.mru.eu)

- ► Enter the Pin-Code.
 - \Rightarrow The selected function test is switched on or off.

9.4. Performing leak test

During the leak test, the system (including the condensate separator) is checked for leaks by the analyser.

For this purpose, the internal gas pump generates a vacuum which is measured by the built-in tension sensor and observed over a period of 10 seconds. Based on the size of the observed pressure drop, the leak tightness of the system is determined.

Operation:

Put the leak test cap # 61382 (for probe tubes Ø 8 mm) onto the probe tip.





With dirt and soot on the probe tube the test cap will not seal properly.

NOTE

 Clean the probe tube before starting the leak proof test.

| Extras menu 🗾 🗾 | | Leak proof test | Leak proof test 🛛 👂 📟 | Leak proof test 🔋 📼 | Leak proof test | , |
|--------------------------|----|------------------|-----------------------|---------------------|-----------------|---|
| Settings | | | | | | |
| Date & time | | | | | | |
| Service menu | | | | | | |
| Default settings | | Establ. pressure | Test in process | Test in process | Test in process | |
| Service values | | | | 10 s | 1s | |
| Leak proof test | | Install test cap | | | | |
| Contents SD card | | | | | | |
| Device info | | | | | | |
| measure storage settings | OK | | | | | |



- ► Go to the Extras menu.
- Select Leak proof test.
- Press OK.
 - \Rightarrow The menu Leak proof test appears.
- Ensure that the leak test cap is plugged on.
 - \Rightarrow Pressure is established.
 - \Rightarrow A 10-second test is running.
 - \Rightarrow A message appears whether the leak proof test was passed or not.
- ► Remove the proof test cap.



If the leak proof test is not passed, you must check the probe including the tubing and the condensate separator.

If no leakage is detected on these external parts, the analyser has to be check service center (service centers at www.mru.eu).

9.5. Contents SD card

| Extras menu 🔋 📼 | | Contents SD card | P 📼 | | | |
|--------------------------|----|------------------|------------|-----|---|--|
| Cottingo | | DID: 2500051 CD | | | | |
| Data & time | | DIR- SUSTEM. 1 | | | | |
| Service menu | | | | | | |
| Default settings | | 1020_A-11110 | | | | |
| Service values | | | | | | |
| Leak proof test | | | | | | |
| Contents SD card | | | | | | |
| Device info | | | | | | |
| | | | | | | |
| | 0K | referet | | F2 | | |
| measure storage settings | | retresh | open | . – | L | |

- ► Go to the Extras menu.
- ► Select Contents SD card.
- ► Press OK.
 - \Rightarrow The menu Contents SD card appears.
 - \Rightarrow The files stored on the SD card are displayed.
- ▶ If necessary, press F2 to refresh.
- ► If necessary, press F3 to open the file.

9.6. Device info

| Extras menu 📕 📼 | | Device info | , | | | | Device info 🗾 💭 | | Type of QR Code | |
|--------------------------|----|-----------------------|---------|-----|---|---|--------------------------------|----|-----------------|----------|
| Settings | | | | | | | | | | |
| Date & time | | Firmware (beta) | 3.00.04 | | | | Eirmware (beta) 3.00.07 | | | |
| Service menu | | Subnumber | 16 | | | | Service history (F1) | | | |
| Default settings | | Meas kernel version | 1.04 | | | | Options list (F2) | | | |
| Service values | | Hardware version | 500 | | | | Bluetooth | | 143.2 | 2 |
| Leak proof test | | Bootloader version | 0.24 | | | | Extras menu (Esc) | | | jî – |
| Contents SD card | | Serial number | 350005 | | | | Send Mail (QR) | | | |
| Device info | | Operating hours | 492.9 | | | | print-out (Pr) | | | <u>8</u> |
| | | Adjustment date 10/ | 11/2021 | | | | Adjustment date 10/14/2021 | | | |
| | 0K | - | | ••• | ◀ | | | OV | | |
| measure storage settings | JI | service hist. options | | |] | ▼ | service hist. options | UK | return | |

- ► Go to the Extras menu.
- Select Device info.
- ▶ Press OK.
 - \Rightarrow The menu Device info appears.
 - ➡ Information about the analyser is displayed, for example serial number and firmware version.



NOTE

You have the option of scanning the device information via OR code and sending it as an e-mail. Use a QR-CODE scanner for this function.

- ▶ If necessary, press the menu key.
 - \Rightarrow A selection list appears.
- ► Select Send Mail ... (QR).
- ► Press OK.
- ► The menu Type of QR-Code appears.
- ► Scan the QR-Code.
 - ⇒ You can the device information as E-Mail.

Options list

- ► Go to the Extras menu.
- Select Device info.
 - \Rightarrow The menu Device info appears.
- ► Press F2.
 - \Rightarrow The menu Options list appears.



NOTE

You have the option of scanning the Options list via OR code and sending it as an e-mail. Use a QR-CODE scanner for this function.



- ► If necessary, press the menu key.
 - \Rightarrow A selection list appears.
- ► Select Send Mail ... (QR).
- ► Press OK.
- ► The menu Type of QR-Code appears.
- ► Scan the QR-Code.
 - \Rightarrow You can send the Options list as E-Mail.

| Service Historie | |
|--------------------|------------|
| Service-Zähler [h] | 0.0 |
| Service am | 07.05.2021 |
| Service am | |
| | |
| | |

Service history

- ► Go to the Extras menu.
- Select Device info.
 - \Rightarrow The menu Device info appears.
- ▶ Press F1.
 - ⇒ The menu Service history appears.
 - ⇒ Information about the date of the last seven service operations appears.

10 Maintenance and care

10.1. Cleaning and care

The analyser requires very little maintenance to maintain its value for a long time:

- occasionally: Cleaning the probe and the probe tube
- after each measurement: Pull off the gas sampling hose on the analyser, so that the hose can dry
- If not used for a longer time, charge the battery first.
- Charge the battery approximately every 4 weeks, if the analyser was not used

10.2. Maintenance

An annual inspection and, if necessary, calibration of the sensors by an MRU service centre is recommended.

NOTE



Please note that correct operation of the The measuring device can only be operated correctly if the sensors are adjusted/calibrated regularly

Have the sensors adjusted/calibrated 1-2 times a year depending on the frequency of use.

10.3. Service messages

The message "Recommendation Customer Service..." is displayed after 1,000 hours or after 11 months at the latest.

If the analyser has an optional 60-month warranty extension, this is displayed in another window. Confirm these messages with F2= OK. The next time you switch on, you will again be reminded to carry out the annual service.

A complete check at an MRU service centre (MRU service centres can be found at www.mru.eu) includes the function check and calibration or cleaning of the following components:

Sensors, pumps, internal / external hose lines, battery, draught, electronics, time and date, temperature inputs, gas sampling probe, condensate separator.

11 Option Gas flow measurement

This option enables the measurement of the flow velocity in flue pipes or flue gas stacks

11.1.Connect Prandtl (Pitot) tube



NOTE

The illustration shows the connection of a Prandtl (Pitot) tube type L without temperature measurement.

- Note that different Prandtl (Pitot) pipes can be connected.
- ► Check your Prandtl (Pitot) tube if necessary.



| Description | Pitot factor | Illustration |
|---------------------------|--------------|--------------|
| Pitot tube type L - with- | 1 | |
| out temperature meas- | | 1 |
| urement | | |
| Pitot tube type L - with | 1 | |
| temperature measure- | | |
| ment | | |
| Pitot tube type S | 0,84 | |

11.2. Open menu Gas flow measurement



- ► Go to the Measurement menu.
- Select Gas flow measurement.
- ► Press OK.
 - ⇒ The menu Gas flow measurement appears.

NOTE

If you have not connected a temperature sensor, the following message appears: ATTENTION! The actual gas temperature must be measured for correct read-ings!



 If necessary, connect a temperature sensor via the temperature connection T2 on the analyser to measure the actual temperature.



If you do not connect a temperature sensor, a value for T-gas of 20°C is automatically assumed.

11.3.Define settings and parameters

| Gas flow measurement | | Settings | | | Settings | V |
|----------------------|---------|----------------------|------|----------|----------------------|----|
| P abs [hPa] | 997 | Setup meas. units | | | Setup meas. units | |
| Cr.s.area [m²] | 0.1000 | P abs | hPa | | P abs | i |
| T-gas °C | 26.6 | Cr.s.area | m² | | Cr.s.area | fe |
| Measuring point no | 1 | v-flow | m/s | | v-flow | 1 |
| Flow vol. | l/s | Flow vol. | l/s | | Flow vol. | m |
| 10 | 70 | Parameter | | | Parameter | |
| 12 | /0 | Gas composition (OK) | | | Gas composition (OK) | |
| v-flow | m/s | Pitot factor | 1.00 | | Pitot factor | 1 |
| 12 | 2.7 | Damping (T90/s) | 4 | | Damping (T90/s) | |
| settings accept | t. hold | return | | V | return | |

- ▶ Press F1.
 - \Rightarrow The menu Settings appear.
- Setup the desired measurement units.
- ► Set the desired parameter.
 - For the Pitot factor of the Prandtl (Pitot) tube see Pitot factor, page 87.

| Settings | | | Settings | , | | | Settings | , |
|---------------------|-------------------|----|--------------------|----------|---|---|--------------------|--------|
| Setup meas. units | | | Gas composition | manual | | | Gas composition | manual |
| P abs | inHg | | standard | Air | | | standard | Gas |
| Cr.s.area | feet ² | | 02[%] | 20.95 | | | 02[%] | 21.61 |
| v-flow | ft/s | | CO2[%] | 0.04 | | | CO2[%] | 0.04 |
| Flow vol. | m³/h | | CH4[%] | 0.00 | | | CH4[%] | 0.00 |
| Parameter | | | H2O[%] | 0.00 | | | H20[%] | 4.60 |
| Gas composition (OK |) | | N2[%] | 79.01 | | | N2[%] | 73.75 |
| Pitot factor | 1.03 | | Molar mass [g/mol] | 28.84 | | | Molar mass [g/mol] | 28.41 |
| Damping (T90/s) | 4 | | | | | | | |
| return | | 0K | standard return | | • | ▼ | standard return | |

- Select Gas composition (OK) to adjust the gas composition to your needs.
- ► Press OK.
 - \Rightarrow A list of the gas composition appears.
- Select standard.
- ► Select the desired gas type.
- ► Set the desired values for O2, CO2, CH4, H20.
 - ⇒ The values for N2 and molar mass adjust automatically.
- ► If necessary, press F1 to set default values.
- ▶ If necessary, press F1 to set standard values.
- Press F2 to exit the menu

11.4. Enter Cross section area

| NOTE |
|---|
| Before you can perform a flow measurement, you must |
| select the desired cross-section and enter the corre- |
| sponding side length |

| Gas flow measurement | , | | | Cross-sect. area | P 📭 | Cross-sect. area | , | | Cross-sect. area | 9 💷 | |
|--------------------------------|----------|---|---|---------------------------|------------|---------------------------|-----------|--|---------------------------|-----------|----|
| P abs [hPa] | 995 | | | | | | | | | | |
| Cr.s.area [feet ²] | 1.0000 | | | Cross-sect. area | Square | Cross-sect. area | Rectangle | | Cross-sect. area | Rectangle | |
| T-gas °F | 76.0 | | | | | | | | | | |
| Measuring point no | 1 | | | Side length [feet] | 1.00 | Side length [feet] | 1.00 | | Side length [feet] | 2.00 | |
| Flow vol. | cfm | | | | | Side length [feet] | 1.00 | | Side length [feet] | 2.00 | |
| 102 | Л | | | Area [feet ²] | 1.0000 | | | | | | |
| 472 | 4 | | | | | Area [feet ²] | 1.0000 | | Area [feet ²] | 4.0000 | |
| v-flow | ft/min | | | | | | | | | | |
| 492 |) 1 | | _ | | | | | | | | |
| -772 | • | | | | | | | | | | F2 |
| settings accept | t. hold | ▼ | | return | | return | | | return | | 12 |

- ▶ Press the arrow keys left/right in the menu Gas flow measurement.
 - ⇒ The menu Cross-sect. area appears.
- ► Select the desired Cross-sect. area.
- Enter the corresponding side lengths.
- Press F2.
 - ⇒ The menu Gas flow measurement appears.

11.5. Perform measurement

The Prandtl tube is inserted vertically into the canal. The probe tip is held against the direction of flow

The total pressure is determined at the tip of the Prantdl pipe. The static pressure is determined at the pressure inlets of the Prantdl pipe. The dynamic pressure corresponds to the difference between the total pressure and the static pressure.

P dyn. = P tot. - P stat.

The flow velocity is calculated according to the following formula:

v = 1,291
$$\sqrt{\frac{1000}{P_{baro} + P_{stat}}} \times \frac{273,15 + T}{289} \times P_{dyn}$$

Legend: P stat << P baro v = flow velocity [m/s] P baro = Barometric pressure [hPa] T = gas temperature P stat = Static pressure [Pa] P dyn. = Dynamic pressure [Pa]

| Gas flow measurement | J 📼 | | Gas flow measurement | | | Gas flow measurement | | Gas flow measurement | |
|--------------------------------|------------|----|--------------------------------|---------|----|--------------------------------|---------|--------------------------------|---------|
| P abs [hPa] | 994 | | P abs [hPa] | 994 | | P abs [hPa] | 994 | P abs [hPa] | 994 |
| Cr.s.area [feet ²] | 4.0000 | | Cr.s.area [feet ²] | 4.0000 | | Cr.s.area [feet ²] | 4.0000 | Cr.s.area [feet ²] | 4.0000 |
| T-gas °F | 76.0 | | T-gas °F | 76.5 | | T-gas °F | 76.5 | T-gas °F | 76.5 |
| Measuring point no | 1 | | Measuring point no | 2 | | Measuring point no | 3 | Number measur. po | oints 2 |
| Flow vol. | cfm | | Flow vol. | cfm | | Flow vol. | cfm | Flow vol. | cfm |
| 19 | 70 | | 21 | 27 | | 23 | 63 | 29 | 954 |
| v-flow | ft/min | | v-flow | ft/min | | v-flow | ft/min | v-flow | ft/min |
| 492 | .1 | 50 | 53 | 1.5 | 50 | 590 |).6 | 73 | 8.2 |
| settings accept | t. hold | F2 | stop accept | zeroing | F2 | stop accept | zeroing | start store | zeroing |

- Press F2 as soon as the measurement for measuring point no. 1 is finished.
 - \Rightarrow The measured values for measuring point no. 1 are taken over.
 - ⇒ Measuring point no. 2 appears in the menu.
- If necessary, carry out measurements for further measuring points and accept the measured values with F2. The measuring point no. is raised accordingly.
- ▶ Press F1.
 - \Rightarrow The measurement is stopped.
- Press F2, to store the measurement.

12 Option: Monitoring flow rate

The flow rate of the sample gas in the analyser is continuously monitored. In the event of an error, the following message appears in the display:



If the flow rate is too low, this message is displayed every 8 seconds. Folgende Fehler können die Ursache sein:

- Water stop filter blocked in the condensate trap (if installed)
- Hose line kinked
- Pump defective

It is recommended to check the filter elements.

If these filter elements are OK, please contact the customer service.

13 Option: Auto-measurement

With the automatic measurement option, the analyser can log continuous measurements independently. You can largely adapt the properties of the automatic measurement to your individual requirements. The data is stored in the internal data memory and can then be transferred to the SD card.

As the size of the data memory is limited, the ratio between total duration and interval is also subject to certain limits if the automatic measuring system is to store values in the data memory. The analyser displays the required memory.

If the required memory is too high, reduce the measurement duration or increase the interval to minimize the required memory.

If there is not enough free memory available, delete the measuring data memory.

When starting a measurement, the Auto-measurement is switched off in principle. You must consciously activate the Auto-measurement via the menu key.

- Start a gas measurement.
 - See also chapter 7.1Perform Gas measurement, Page 39.



- Press the menu key.
 - \Rightarrow A selection list appears.
- ► Select Auto-measurement.
- Press OK.
 - ⇒ The menu Auto-measurement appears.
- ► Set the desired values and select the desired site.

NOTE



Setting Average values: Yes: Analyser calculates the mean during each interval

and stores this value.

No: Analyser stores the values being measured at the end of the interval.

| Program 1, Natural ga | is 🔋 🔲 | Program 1, Natural gas | P 📼 | Program 1, Natural gas | I A |
|--------------------------|--------|--------------------------|------------|--------------------------|--------|
| 02 % | 20.9 | 02 % | 20.8 | 02 % | 20 |
| Dewpoint °F | 32.0 | Dewpoint °F | 32.0 | Dewpoint °F | 32 |
| T-air °F | 76.5 | T-air °F | 76.5 | T-air °F | 76 |
| T-gas °F | 76.5 | T-gas °F | 76.5 | T-gas °F | 76 |
| co ppm/ref3%02 | 0 | CO ppm/ref3%02 | 0 | CO ppm/ref3%02 | |
| CO2 % | 0.0 | CO2 % | 0.1 | CO2 % | 0 |
| 02 % | 20.9 | 02 % | 20.8 | 02 % | 20 |
| stop | 2:00 | stop | 0:11 | start store | >clipb |

- ► Press F1.
 - \Rightarrow The measurement starts.
 - \Rightarrow The display shows the remaining time of the measurement.
 - ⇒ After the set measuring time has elapsed, the measurement stops automatically.
- ▶ Press F2, to store the measurement.
 - See also chapter 7.10 Store measurement values, Page 60.
 - For exporting measurements see also chapter Export measurements, Page 74.

14 Option: Perform measurements with Extraction box

The Extraction box is a clip-on box that extracts the gas at the outlet grid. With the Extraction box you can prevent toxic gases from escaping at the outlet grille during a gas measurement. With a hose connected, you can discharge toxic gases into a safe environment.



| Position | Description |
|----------|---------------------------------|
| 1 | Connection sample gas discharge |
| 2 | Plug 4-pin |
| 3 | Holding magnets |

14.1. Attach Extraction box to analyser





NOTE The Extraction box is attached to the back of the analyser. The Extraction box is attached to the analyser via holding magnets. You do not need any further attachment material.

- ► Guide the Extraction box to the back of the analyser.
- ▶ Pay attention to the position of the holding magnets on the analyser.
 - See also chapter 3.2 Analyser, page 14.
 - \Rightarrow The Extraction box is attached to the analyser.

14.2. Connect Extraction box to analyser



- Insert the Plug 4-pin into the connector Tgas/Aux. Ensure that the red markings on the Plug 4-pin and the connector Tgas/Aux match.
- ▶ Plug a hose onto the Connection sample gas discharge.
- ► Guide the hose into a safe environment.
 - \Rightarrow The Extraction box is connected to the analyser.
 - ⇒ The hose for discharging the sample gas is attached and laid outside.

14.3. Activate Extraction box

Before you can use the Extraction box, you must activate the Extraction box in the menu Settings.

| Settings | , | Settings | | Settings | |
|----------------------|-----------|--------------------|------------|-----------------|-----------------------------|
| Language | English | Language | English | Language | English |
| LED condensate trap | 50% | LED condensate t | rap 50% | LED condensa | te trap 50% |
| Helpful hints | ON | Helpful hints | ON | Helpful hints | ON |
| Font S | Standard | Font | Standard | Font | Standard |
| Cursor colour | Classic | Cursor colour | Classic | Cursor colour | Classic |
| Power-ON protection | OFF | Power-ON protec | tion OFF | Power-ON pro | tection OFF |
| Keyboard beep | OFF | Keyboard beep | OFF | Keyboard bee | p OFF |
| Extraction box | OFF | Extraction box | ON | Extraction box | on on |
| 400DH (external prob | e) OFF | Trailing extractio | n box 10 | Trailing extrac | tion box 30 |
| print-out ea | asurement | print-out | easurement | print-out | easurement |

- ► Go to the menu Settings.
 - See also chapter 5.2 Customize settings, page 23.
- Search for the menu item Extraction box.
- Activate the Extraction box.
 - \Rightarrow An icon appears in the menu bar.
 - ⇒ The menu item Trailing extraction box appears.

| NOTE |
|--|
| The Trailing of the extraction box can be set from 10 to |
| 120 seconds. |
| As soon as the gas pump of the analyser stops, the Ex- |
| traction box remains switched on for the set overrun |
| time so that any remaining sample gas can be ex- |
| tracted. |
| The icon in the menu bar that the monitoring of the |

Extraction box is activated. The suction pump is off.

14.4. Perform measurement

- ▶ Perform the desired measurement.
 - See also chapter 7.1 Perform Gas measurement, page 39.

| Program 1, Natural ga | 5 |
|--------------------------|------------|
| T-gas °C | 22.2 |
| CO2 % | 0.0 |
| 02 % | 21.0 |
| T-diff. °C | -0.3 |
| co ppm/ref0%02 | 0 |
| Draft hPa | -0.00 |
| T-gas °C | 22.2 |
| stop save | >clipboard |

The icon in the menu bar indicates that the Extraction box is in operation. The suction pump is running.

NOTE

Monitoring whether the Extraction box is connected and extracting does not take place.

As long as the suction pump is in operation, not all menu items can be selected. Only after the set time for trailing has elapsed can all menu items be selected again.



In this example, Particul. matter measur. and AUX Anemometer are not selectable as long as the Extraction box is in operation.



15 Prefilter for high dust concentrations

The pre-filter (article no. 56356A) is inserted into the hose line directly after the probe handle if required.



Before you can insert the pre-filter, you must shorten the hose line (gas line).

- ▶ Pull the hose line (gas line) out of the probe handle.
- ► Shorten the hose line (gas line) by approx. 9 cm.
- Insert the pre-filter between the hose line (gas line) and the probe handle.



- ► Check the pre-filter before and after each measurement.
- ▶ Replace the filter tablets (art. no.# 52798) if necessary.

For the handling with filter tablets from glass wool we recommend the use according to the IPCS safety data sheet:

- Safety googles
- Mouth/nose mask
- Protective gloves



MRU GmbH, D-74172 Neckarsulm

16 Appendix

16.1.Technical data

| General data | |
|--|-----------------------------------|
| Operating temperature | +5°C +45 °C / |
| | +41°F +113 °F |
| Rel. Humidity, non-condensing | 95% |
| Storage Temperature | -20°C - +50°C / |
| | -4°F 122° F |
| Internal Battery Pack, operating hours (typical) | Li-Ion, 16 h |
| Power supply | 100 – 240 V / 5V DC / 1.200 mA |
| Weight with 2 sensors | 750 g / 1.65 lbs. |
| Size | 244 x 113 x 54 mm / |
| | 4.3x 8.8 x2.04 in |
| Housing material | PA6 |
| IP protection with protection cap | IP30 |
| Max suction range gas pump | 150 hPa |
| gas flow typ. | 60 l/h |
| Measured values | |
| Electrochemical Sensor | O ₂ |
| Measuring Range | 021 % |
| Resolution (standard) | 0,1 % |
| Resolution (optional) | 0,01 % |
| Abs. Accuracy | ± 0,2 Vol.% |
| Response Time T90 | < 20s |
| Years expected lifetime (@air) | 2 |
| CO ₂ tolerance | 20 Vol.% |
| Electrochemical Sensor | O ₂ Long Life |
| Measuring Range | 0- 21 Vol.% |
| Resolution (standard) | 0,1 % |
| Resolution (optional) | 0,01 % |
| Abs. Accuracy. | ± 0,2 Vol.% |
| Response Time T90 | < 20s |
| Years expected lifetime (@air) | 3 |
| CO ₂ tolerance up to | 100 Vol.% |
| Electrochemical Sensor | O ₂ Very Long-Life |
| Measuring Range | 0 – 21 Vol.% |
| Resolution (standard) | 0,1 % |
| Resolution (optional) | 0,01 % |
| Abs. Accuracy | ± 0,2 Vol.% |
| Response Time T90 | < 20s |
| Years expected Life Time (@air) | 4 |
| CO₂tolerance up to | 100 % |

MRU GmbH, D-74172 Neckarsulm

| (requires recovery time of double the exposure | | |
|--|---------------------------------|--|
| time for CO ₂ > 20 Vol%) | | |
| | | |
| Electrochemical Sensor | Measuring range extension | |
| Mara da Dava | up to 25% (Option #62414) | |
| Measuring Range | 025 Vol% | |
| Resolution | 0,1 % | |
| Abs. Accuracy | ± 0,2 VOI.% | |
| Response Time 190 | <20s | |
| Electrochemical Sensor | 0 | |
| H ₂ – compensated | 0 | |
| Nom. Measuring Range | 0 – 10000 ppm | |
| Overload Range | < 20000 ppm | |
| Resolution | 1 ppm | |
| Accuracy abs. / reading | ± 10 ppm | |
| | 5% (0 – 4000 ppm) | |
| | 10% (> 4000 ppm) | |
| Response Time T90 | < 40s | |
| | | |
| Option | CO low | |
| Measuring Range | 500 ppm | |
| Resolution | 0,1 ppm | |
| Accuracy | ± 2ppm / 5 % | |
| Electrochemical Sensor | CO high (Option #63057) | |
| Nom. Measuring Range | 0 – 4000 ppm | |
| Overload Range | < 20000 ppm | |
| Resolution | 1 ppm | |
| Accuracy abs. / reading | ± 10 ppm / | |
| | 5% (0 – 4000 ppm) | |
| | 10 % (> 4000 ppm | |
| Response Time 190 | < 40s | |
| Electrochemical Sensor | CO very high (Option #63134) | |
| Nom Measuring Bange | 0.40000ppm/(0.4%) | |
| Overload Range | < 100,000 ppm/ (0478) | |
| Resolution | 0 100000 | |
| | 0.10000.1 | |
| | >=1%:10ppm /(0,001%)/ | |
| Accuracy abs. / reading | ± 200 ppm / | |
| | 5% (040.000 ppm / | |
| | (0%)) | |
| | 10% (>100.000 ppm/ | |
| | (<10%)) | |
| Response Time T90 | <40s | |
| Electrochemical Sensor | NO (Option #63058) | |

MRU GmbH, D-74172 Neckarsulm

| Nom. Measuring Range | 0 – 1000 ppm | |
|--|-------------------|--|
| Overload Range | < 5000 ppm | |
| Resolution | 1 ppm | |
| Accuracy abs./reading | ± 5ppm | |
| | 5% (0 – 1000 ppm) | |
| | 10% (> 1000 ppm) | |
| Response Time T90 | < 30s | |
| Option | NO low | |
| Measuring Range | 0300 ppm | |
| Resolution | 0,1 ppm | |
| Accuracy | 2ppm / 5% | |
| | | |
| Electrochemical Sensor | NO2 | |
| Nom. Measuring Range | 0200ppm | |
| Overload Range | <1000 ppm | |
| Resolution | 1 ppm | |
| Accuracy abs./reading | ± 5ppm | |
| | 5% (0-200ppm) | |
| | 10% (>200 ppm) | |
| Response Time T90 | < 60 s | |
| Option | NO2 low | |
| Measuring Range | 0 300 ppm | |
| Resolution | 0,1 ppm | |
| Accuracy | 4ppm / 5% | |
| Electrochemical Sensor | SO2 | |
| Nom. Measuring Range 02000ppm | | |
| Overload Range | <5000 ppm | |
| Resolution | 1 ppm | |
| Accuracy abs. / reading | ± 10 ppm/ | |
| | 5% (02000 ppm) | |
| | 10% (>2000 ppm) | |
| | | |
| Option | SO2low | |
| Measuring Range 0300 ppm | | |
| Resolution | 0,1 ppm | |
| Accuracy | 4 ppm / 5% | |
| Electrochemical Sensor | H ₂ | |
| Nom. Measuring Range | 01000 ppm | |
| Overload Range | < 2000 ppm | |
| Resolution | 1 ppm | |
| Accuracy abs. / reading | ± 5 ppm / | |
| | 5 % (0500 ppm) | |
| | 10% (>500 ppm) | |
| Electrochemical Sensor placed on addi- | H2S | |
| tional position | | |

| (depending on configuration) | | | |
|---|------------------|--|--|
| Nom. Measuring Range | 0500 ppm | | |
| Overload Range | < 2000 ppm | | |
| Resolution | 1 ppm | | |
| | | | |
| | | | |
| Accuracy abs. / reading | ± 5 ppm / | | |
| | 5% (0 500ppm) | | |
| | 10 % (>500 ppm) | | |
| Response Time T90 | <40s | | |
| Electrochemical Sensor placed on addi- | H2S | | |
| tional position | | | |
| (depending on configuration) | | | |
| Nom. Measuring Range | 02000 ppm | | |
| Overload Range | <5000 ppm | | |
| Resolution | 1 ppm | | |
| Accuracy abs. / reading | ± 10 ppm / 10% | | |
| Response Time | <40s | | |
| Non-dispersive Infrared Measurement | CO2 | | |
| (NDIR) | | | |
| Nom. Measuring Range | 040 Vol% | | |
| Resolution | 0,01 Vol% | | |
| Accuracy abs. / reading | ± 0,3 Vol% / 3% | | |
| Response Time T90 | <35s | | |
| Non-dispersive Infrared Measurement (NDIR) | CH4 | | |
| Nom. Measuring Range | 10040000 ppm | | |
| Resolution | 10 ppm | | |
| Accuracy abs. / reading | ± 400 ppm / 5% | | |
| Response Time T90 | < 35 s | | |
| Temperature measurement | T1, T2 | | |
| Number of thermocouple type K input | 2 | | |
| Measuring Range | -40 °C - 1200 °C | | |
| Accuracy abs. / reading ±2°C/ | | | |
| | 0,5% | | |
| | | | |
| Flue gas temperature (using MRU probe) | TA | | |
| Measuring Range with high grade steel | 0 - 800°C | | |
| probe pipe | | | |
| Measuring range with Inconel probe pipe | 0 - 1100°C | | |
| Accuracy abs. / reading | ±2°C/ | | |
| | 0,5% | | |
| Ambient temperature | Т | | |
| (using MRU sensor) | | | |

| Measuring Range with ambient temperature 0 - 100°C | | |
|--|------------------|--|
| probe | | |
| Accuracy. | 1 ℃ | |
| Accuracy abs./reading | ±1°C | |
| Draft | | |
| Measuring Range | ± 100 hPa | |
| Accuracy abs. / reading | 0,02 hPa / | |
| | 1% | |
| Differential Pressure | | |
| Measuring Range | ± 100 hPa | |
| Accuracy abs. / reading | 0,02 hPa oder 1% | |

| Calculated values | |
|---------------------------------------|--|
| | |
| | CO ₂ |
| Measuring range (fuel type dependant) | 0 - CO ₂ max |
| Accuracy abs. | ± 0,3 Vol. % |
| Air ratio | |
| Measuring Range | 1 - 20 |
| Excess Air | |
| Measuring Range 0 - 999% | |
| PI (Poison Index / Ratio) | |
| Measuring Range 0.0001 - 10.0 | |
| Dew point | |
| | °C |
| Losses qA | |
| Measuring Range 0 - 99,9% | |
| Efficiency | |
| Measuring Range 0 - 120% | |
| Measurement values available as | Mg/Nm ³ |
| | O ₂ Ref |
| | mg/kWh |
| | NO _x : mg/Nm ₃ NO ₂ |

| Velocity | V | |
|--|--|--|
| Based on differential pressure measurement | | |
| with Pitot tube | | |
| | | |
| Measuring range differential pressure | 100 hPa | |
| Accuracy differential pressure | ±0.5 Pa / 1% with | |
| | <5°C temp. change | |
| | <30 min meas. time | |
| Measuring range absolute pressure | 600 hPa 1150 hPa | |
| Accuracy of absolute pressure measurement | ± 10 hPa | |
| Measuring range velocity measurement | 1 m/s 100 m/s | |
| Accuracy without error of Pitot tube | ±1 m/s (0 <v<2m s)<="" td=""></v<2m> | |
| | ±0.2 m/s (2 <v<10m s)<="" td=""></v<10m> | |
| | ±0.5% (v>10m/s) | |

16.2. Analysis and calculation

| Continuous conversions to NO | NO |
|---|----|
| [ppm] related to. on 0% rest O2 (undiluted) | Х |
| [ppm] related to. on fuel type dependent O2 reference value | Х |
| [mg/m ³] | Х |
| [mg/kWh] | Х |
| [mg/MJ] | Х |
| [mg/m ³] on fuel type dependent O2 reference value | Х |

| Calculated values | |
|---------------------------------------|--|
| | CO2 |
| Measuring range (fuel type dependant) | 0 - CO2max |
| Accuracy abs. | ± 0,3 Vol. % |
| Air ratio | |
| Measuring Range | 1 - 20 |
| Excess Air | |
| Measuring Range | 0 - 999% |
| PI (Poison Index / Ratio) | |
| Measuring Range 0.0001 - 10.0 | |
| Dew point | |
| | °C |
| Losses qA | |
| Measuring Range | 0 - 99,9% |
| Efficiency | |
| Measuring Range | 0 - 120% |
| Measurement values available as | Mg/Nm ³ |
| | O ₂ Ref |
| | mg/kWh |
| | NO _x : mg/Nm ₃ NO ₂ |

| Continuous conversions to CO | со |
|---|----|
| [ppm] related to. on 0% rest O_2 (undiluted) | Х |
| [ppm] related to. on fuel type dependent O2 reference value | Х |
| [mg/m ³] | Х |
| [mg/kWh] | Х |
| [mg/MJ] | Х |
| [mg/m ³] on fuel type dependent O2 reference value | Х |

| Measured values | Unit |
|------------------------------------|-----------|
| O ₂ | [%] |
| СО | [ppm] |
| СО | [%] |
| NO | [ppm] |
| NO ₂ | [ppm] |
| SO ₂ | [ppm] |
| Temp. Ambient air (Thermo-Element) | [°C] [°F] |
| Temp. Flue gas (Thermo-Element) | [°C] [°F] |
| СО | [ppm] |
| Draft | [hPa] |

| Further continuously calculated measured values | Unit |
|---|-----------|
| CO ₂ | [%] |
| Efficiency ETA | [%] |
| Efficiency ETA condensed | [%] |
| Losses | [%] |
| Losses condensed | [%] |
| Lambda | - |
| Dew point | [°C] [°F] |
| CO / CO ₂ ratio | [%] |

16.3. Reset analyser

If the analyser no longer responds, you can perform a reset.

▶ Press the ESC button and the ON/OFF button simultaneously.

16.4. Troubleshooting

Troubleshooting on the analyser

| Effect | Error | Cause | Solution |
|---|--|---|--|
| | indication | | |
| Analyser does not respond to any key touch | | Device does not react on any key. | Press ESC and Power-ON buttons at the simultaneously. |
| Undercooling inside the an- alyser, the an- alyser is not usable. | Display indica- tion: "Device too cold" or audible sound every 5 sec | e.g. analyser was stored in a cold place during winter. | Put the device to a warm room and wait |
| Measured val- ues are not correct | Error when tak- ing zero point | Sensors are already ex- posed to gas when taking the zero point. | Vent the analyser with fresh air and re- start. |
| Analyser does not switch on or does not react after switching on. | | Battery discharged. | Connect the analyser to the line power in order to charge the battery. |
| Measurement without exact temperature values. | Temperature indication: | Thermoelement defective, balancing network inter- rupted or not connected. | Call our after-sales service. Remove probe from the gas duct and condensate from the probe tube |
| Wrong measuring values | Measuring range exceeded: Value O ₂ too high Values CO and CO ₂ to low . | Connection probe – device not correct. Leakage at probe / tube / condensate separator, pump does not suck correctly | Perform leak proof test. By visual control of probes, tubes condensate separa- tor, leaking parts could be found. |
| Wrong measuring values | Gas tempera- ture is too hot or alternates | Probe is not plugged in correctly, defective cable in the probe line, formation of condensate at the probe tip. | Check probe plug re- spectively probe line regarding dam-ages (loose connection), remove condensate from the probe tip. |

Troubleshooting condensate separator

| 1. Effect | 2. Cause | 3. Solution |
|--|---|---|
| Dirt and / or humidity in- side the device No filter effects Sensor failure Pump failure | Fine filters are wet and / or dirty. | Check filters more often Renew them if necessary white = OK Brown-black = re- new |
| Wrong measuring values | Cover, intermediary unit, plexiglass tube and locking pieces are not tightly fixed respec- tively screwed | Check tight- ness with every filter change. |
16.5. Update firmware

Extras menu , 📕 💼 Device info Settings Date & time Firmware version 3.00.02 Service menu Subnumber 12 Default settings Meas kernel version 1.04 Service values 500 Hardware version Leak proof test Bootloader version 0.24 Contents SD card Serial number 350006 **Device info Operating hours** 474.8 Adjustment date 10/14/2021 0K service hist. options measure storage settings

Check current firmware version

- ► Go to the Extras menu.
- ► Select Device info.
 - \Rightarrow The menu Device info appears.
 - ⇒ The current firmware version appears. In this example, the firmware version is 3.00.02.

In case there are any problems with updating the firmware, we need some information from you.

- ► Write down the current Firmware version.
- ► Write down the Serial number.

Prepare SD card

If you have not received the new firmware on an SD card, but for example by e-mail, you must copy the file "All 1122.fwb" to the root directory (not to a subdirectory) of the SD card. You may have received this file packed in a ZIP file. Unpack the file before you copy the file to the SD card.

Perform firmware update

- Copy the file "All 1122.fwb." to an SD card into the main directory (not into any subdirectory).
- Switch on the analyser.
- ► Wait until the zero-point measurement is finished.
- ► Insert the prepared SD card into the analyser
 - ⇒ A message appears.

| Measurement menu | |
|------------------------------|----|
| New firmware | |
| | |
| tound on the flash disk: | |
| V3.00.05-34 | |
| currently installed version: | |
| V3.00.02-12 | |
| | |
| ignore | |
| install firmware | |
| | |
| | |
| AUX-Humidity | |
| • | OK |
| start storage extras | UN |

- ► Select install firmware.
- ▶ Press OK.
 - \Rightarrow The update is performed.
 - ⇒ After the update has been performed, a message appears.

| Mea | isurement menu | • |
|-----|--------------------|----|
| 0 | | |
| G | New firmware | - |
| P | was installed. | |
| D | | |
| Т | Possible adaptions | |
| Р | were done. | |
| η. | | |
| - | | |
| G | _ | - |
| A | | |
| AU | X-Humidity | |
| | • | |
| | storage extras | UK |

- ► Confirm the message with OK.
- Switch the analyser off again after the successful update.
 - ⇒ All functions are available the next time the analyser is switched on.

Check new firmware version

| Extras menu 👂 📼 | | Device info | |
|--------------------------|----|-----------------------|---------|
| Settings | | | |
| Date & time | | Firmware version | 3.00.05 |
| Service menu | | Subnumber | 34 |
| Default settings | | Meas kernel version | 1.04 |
| Service values | | Hardware version | 500 |
| Leak proof test | | Bootloader version | 0.24 |
| Contents SD card | | Serial number | 350006 |
| Device info | | Operating hours | 475.2 |
| | | Adjustment date 10/ | 14/2021 |
| measure storage settings | OK | service hist. options | |

- ► Go to the Extras menu.
- Select Device info.
- ► Press OK.
 - \Rightarrow The menu Device info appears.
 - \Rightarrow The new Firmware version is displayed.
- Repeat the update process if the old firmware version is still displayed.

In case of error

What to do if there were problems during the update? In the event of an error, the red LED of the condensate separator flashes. The inserted SD card was then not recognized. (Check whether the SD card is inserted correctly and perform a reset by pressing the ESC and ON keys simultaneously).

Where can I get help if the update was not successful? Contact your local sales representative or via email: Email: info@mru.de

16.6. Display your own logo

You have the option of importing your own start logo into the analyser and having it displayed when you switch the analyser on.

Create your own logo

Create your own logo.

The following is an example of how to create a logo using MS Paint[®]. You can also create your logo with another graphics program.

► Open the graphics program.



Adjust the file size. The file size must be 480 pixels (horizontal)x 800 pixels (vertical).



Erstellen Sie Ihr eigenes Logo Create your own Logo

Save your logo to an SD card with the file name logo4u.jpg.

| | NOTE |
|---|---|
| | When saving/exporting, pay attention to the file format .jpg. |
| | If you use a graphics programme other than MS Paint, you must observe the following points: |
| | The JPG decoder in the unit works according to this standard: |
| i | JPEG compression standard (JPEG ISO/IEC10918- 1ITU-T) JFIF file format standard (JPEG file interchange for- mat) |
| | Note the following settings in the graphics programme: |
| | Do not use arithmetic codingDeselect progressiveDo not save preview and colour profile |
| | If necessary, change the settings in your graphics programme. |



Import logo into analyser

▶ Insert the SD card with the file logo4u.jpg into the analyser.

| Contents SD card | • | Contents SD card | | | Contents SD card | |
|------------------------|----|------------------|-----|----|-------------------------------|-----|
| <dir> 081877.MON</dir> | | | | | <dir> 081877.MON</dir> | |
| <dir> 081878.MON</dir> | 1 | Change the | | | <dir> 081878.MON</dir> | |
| <dir> 082040.MON</dir> | | start logo | | | <dir> 082040.MON</dir> | |
| <dir> 082042.MON</dir> | | device? | | | <dir> 082042.MON</dir> | |
| <dir> 082050.MON</dir> | | | | | COLOR Logo image saved | |
| <dir> 350823.LCD</dir> | | No | | | <dir> 350823.LCD</dir> | |
| <dir> SYSTEM~1</dir> | | Yes | | | <dir> SYSTEM~1</dir> | |
| 1122.FWB | | | | | 1122.FWB | |
| Logo4U.JPg | | LOGO4U.JPG | | | LOGO4U.JPG | |
| delete refresh open | F3 | delete refresh o | pen | ОК | delete refresh o | pen |

- ► Go to the menu Contents SD card.
 - See also chapter 9.5 Contents SD card, page 82.
- Search for the file LOGO4U.JPG
- Press F3.
 - ⇒ A window appears.
- Select Yes
- ► Press OK.
 - \Rightarrow The Logo image is saved.

NOTE

If you want to import a different logo, repeat the procedure described here with a new logo.

17 Declaration of conformity



MRU Messgeräte für Rauchgase und Umweltschutz GmbH



Fuchshalde 8 + 12 74172 Neckarsulm-Obereisesheim Deutschland / *Germany* Tel.: +49 (0) 7132 - 99 62 0 Fax: +49 (0) 7132 - 99 62 20 E-Mail / *mail*: <u>info@mru.de</u> Internet / *site*: <u>www.mru.eu</u>



Bevollmächtigte Person, für die Zusammenstellung der technischen Unterlagen Person authorized to compile the technical documents.

| Name / <i>name:</i> | Dierk Ahrends |
|------------------------------|--|
| Funktion / function: | QM-Beauftragter / QM-Representative |
| Firmenname / <i>company:</i> | Messgeräte für Rauchgase und Umweltschutz GmbH |
| Straße / <i>street:</i> | Fuchshalde 8 + 12 |
| Ort / city: | 74172 Neckarsulm |
| Land / country: | Deutschland / Germany |
| | |

Produkt/Product

| Bezeichnung / designation: | Gasanalysator |
|----------------------------|-----------------------------------|
| | Gas analyser |
| Produktname / <i>name:</i> | ΟΡΤΙΜΑ |
| Funktion / function: | Gasanalyse / g <i>as analysis</i> |

Hiermit erklären wir, dass das oben beschriebene Produkt allen einschlägigen Bestimmungen entspricht, es erfüllt die Anforderungen der nachfolgend genannten Richtlinien und Normen:

We declare the conformity of the product with the applicable regulations listed below:

- EMV-Richtlinie / EMV-directive 2014/30/EU
- Niederspannungsrichtlinie / low voltage directive 2014/35/EU
- RoHS-Richtlinie / RoHS directive 2011/65/EU (RoHS II)

Neckarsulm, 11.04.2022

Even hily

Erwin Hintz, Geschäftsführer / Managing Director



MRU · Messgeräte für Rauchgase und Umweltschutz GmbH

Fuchshalde 8 + 12 74172 Neckarsulm-Obereisesheim Fon 07132 99620 · Fax 07132 996220 info@mru.de · www.mru.eu